


**Milling, plotting, engraving,  
drilling, grinding, dispensing,  
cutting and much more besides  
with...**

# ***WinPC-NC***

## ***Light***

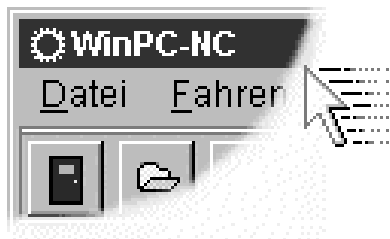

**...the software that turns your  
standard PC into a universal  
stepper motor NC unit**

**Version 2.00  
July 2006**

Lawful purchase of the diskette and the manual conveys permission for one person to utilise the **WinPC-NC** control program. Copying the diskette and the manual or changing any of the individual files or elements of the manual are forbidden.

Furthermore any unauthorized transmission of the program or extracts of it will be legally prosecuted by all available means.

The authors reserve all rights to the programs and to the manual, in particular the copyright.

This control program has undergone extremely thorough testing. Nevertheless, it is impossible to give a guarantee for completely fault-free operation. Furthermore, no responsibility can be accepted for damage caused as a result of using our program.

Despite the most strenuous efforts, it is never possible to completely eliminate all faults. Consequently, we would be grateful to receive feedback from users.

**Please note that support assistance and reduced updates are only available for registered customers. In order to be registered please send us a mail indicating version number and serial number (either noted on the CD or visible in the program window) as well as your complete address.**

**Please register your licence !!!!**

**Burkhard Lewetz**  
**Hardware-Software**  
Brückenstrasse 7  
D-88074 Meckenbeuren  
eMail [info@lewetz.de](mailto:info@lewetz.de)  
Homepage [www.lewetz.de](http://www.lewetz.de)

July 2006

MS-Windows is a registered trademark of the Microsoft Corporation.  
AutoSketch, AutoCAD, AutoSketch for Windows are registered trademarks of Autodesk AG.  
IBM is a registered trademark of the International Business Machines Corporation.  
CorelDRAW is a registered trademark of the Corel Corporation.  
Designer is a registered trademark of Micrografx,  
Borland C++Builder is a registered trademark of Borland International, INC.  
Other products mentioned by name are trademarks or registered trademarks of their corresponding companies.

2.000

# Table of contents

The structure of this manual.....	5
Definitions.....	5
Use of typography.....	6
Various versions of <b>WinPC-NC</b> .....	7
 1. What can <b>WinPC-NC Light</b> do ? .....	 8
 2. First steps.....	 12
2.1. Requirements to the PC hardware.....	12
2.2. Possible restrictions during realtime operation.....	12
2.3. Installation.....	13
2.4. Launching the program.....	14
2.5. First steps and test moves.....	15
2.6. Exiting <b>WinPC-NC</b> .....	17
 3. Operating <b>WinPC-NC Light</b> .....	 18
3.1. Graphical display of the NC file.....	18
3.2. Drop-down menus and function keys .....	21
3.3. The individual menus.....	22
3.3.1. FILE menu .....	22
OPEN .....	22
OPEN WITHOUT PARAMETERS .....	23
EDIT.....	23
EXIT .....	23
3.3.2. MOVE menu.....	23
START .....	24
JOG .....	24
JOYSTICK JOG .....	26
REFERENCE MOVE.....	27
SELECT TOOL .....	27
3.3.3. PARAMETERS menu.....	28
SAVE .....	29
SAVE AS .....	30
LOAD .....	30
3.3.4. SPECIAL FUNCTIONS menu .....	30
SIGNAL TEST.....	31
MOTOR TEST .....	32
STATUS INFORMATION.....	33
JOYSTICK CALIBRATION.....	33
CHECK POSITION .....	34
3.3.5. HELP menu.....	35
TOPICS.....	35
DISCLAIMER.....	35
ABOUT <b>WinPC-NC</b> .....	35

4. Parameter settings.....	36
4.1. Tool management.....	36
4.2. Speeds.....	39
4.3. Coordinates.....	41
4.4. Data format and associated parameters.....	44
4.5. Miscellaneous parameters.....	47
4.6. Ports.....	52
4.7. Signals and dwell times.....	54
4.8. Machine parameters .....	55
5. Initial start-up with the machine.....	60
5.1. Connecting the machine.....	60
5.1.1. Pin assignment of clock/direction version.....	61
5.1.2. Pinning of SMC version.....	62
5.2. Determination of axis resolution.....	63
5.3. Definiton of LPT port.....	63
5.4. Determination of move direction .....	65
5.5. Adjustment of reference switches.....	66
5.6. Sequence and direction of reference move.....	68
5.7. Control of adjustments.....	68
5.8. Additional steps.....	69
6. Signal wizzard.....	70
6.1. Using input and output signals.....	70
6.2. Assignment of inputs.....	71
6.3. Assignment of output liness.....	73
6.4. Input signals available.....	74
6.5. Output signals available.....	75
7. Additional information.....	76
7.1. Interpreters.....	76
7.1.1. HPGL.....	76
7.1.2. Drilling formats.....	78
7.2. Error messages.....	79
7.3. Special versions of <b>WinPC-NC</b> .....	82

## The structure of this manual ...

This manual provides you with all the information needed for using *WinPC-NC*. It is divided into individual chapters, the contents of which are summarised below:


- Chapter 1:** Brief explanation about *WinPC-NC*, the possibilities for using it and the hardware requirements.
- Chapter 2:** Initial start-up procedure, description of how to install the program and how to adjust the initial specific parameters.
- Chapter 3:** More detailed descriptions of how to operate the program and the individual functions of *WinPC-NC*.
- Chapter 4:** Explanation of all parameters and the setting options.
- Chapter 5:** Initial start-up procedure step by step
- Chapter 6:** Information concerning definitions and adjustments of input/output signals
- Chapter 7:** Further technical information about the program, about the implemented NC format interpreters, error messages and special versions.

## Definitions


Some of the terms used in this manual may require an explanation:

- Job file**  
or  
**NC file**      A file with NC data which is read and processed by *WinPC-NC*. Depending on the application, the file may contain milling, plotting, drilling data or other types of data.
- Job process**      The process of reading and processing a job file and the resultant actuation of the machine.
- Command**      An individual instruction in the job file which gives rise to actions by the machine or in *WinPC-NC*.
- Button**      Mouse clickable field to activate a certain function
- Checkbox**      Box for activating or deactivation a certain parameter or function, e. g. signals. An activated checkbox is marked with a cross.

Descriptions of the machine and the movement directions of the individual axes are made with reference to the following mechanical layout of a flat-bed machine. The assignment of axes depend on your personal position and your viewport to the machine.

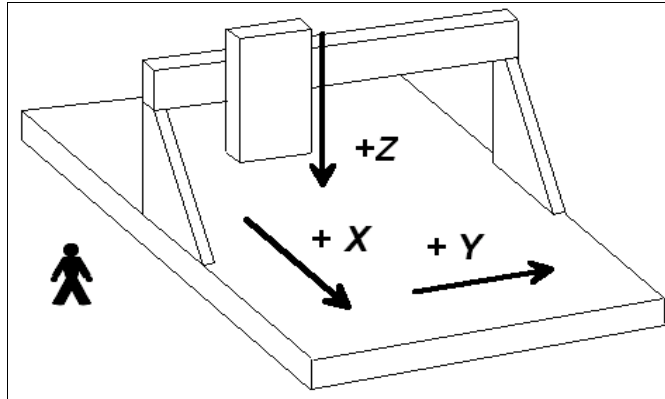

Schematic layout of a flat-bed machine with your position aside

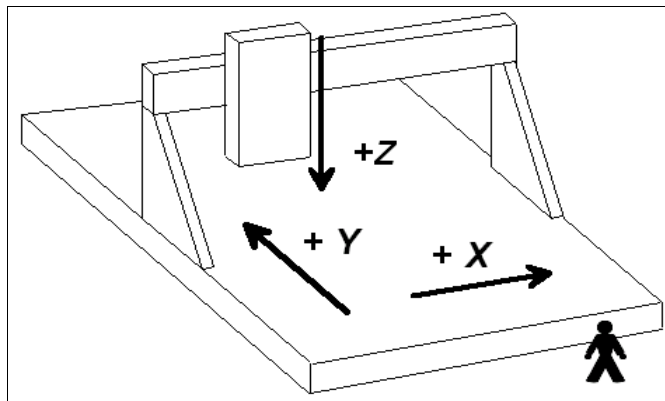

Schematic layout of a flat-bed machine with your position in front of

## Use of typography

<b>Keyboard entries</b>	Normal script enclosed in a box, e.g. (ENTER)
<b>Cursor keys</b>	Normal script enclosed in a box with english defintions, e.g. (UP), (LEFT), (PGDN)
<b>Menu functions</b>	Capital letters with menu path, e.g. <i>FILE-DISPLAY</i>
<b>Messages</b>	Italic script, e.g. <i>'Perform reference movement? Y/N'</i>
<b>Function names</b>	Capital letters, e.g. <i>SIGNAL TEST</i>

## Different versions of *WinPC-NC*

The controlling program *WinPC-NC* is available in three different versions.

Our lowcost program *WinPC-NC Light* offers all necessary functions for beginners, e.g. engraving, milling, drilling and PCB drilling or manufacturing modelling parts.

*WinPC-NC Economy* is equipped with additional functions and offers with up to four axes a lot of special functions and provides support of extraordinary mechanical components.

This program disposes of much more format interpreters as the version for beginners.

*WinPC-NC Light* and *Economy* are also available for SMC stepper cards, i. e. motors are not controlled by clocking/direction signals but by SMC signals.

*WinPC-NC Professional* is considered as industrial version and runs only in combination with our external axes controller CPU and is therefore most qualified for all true realtime tasks. The program is fairly independent of windows speed and provides besides utmost stability and reliability additional professional technology functions.

---

# 1. What can WinPC-NC Light do ?

---

*Universal program*

**WinPC-NC** is a software program which takes any standard personal computer and turns it into a universal NC control system for up to 3 axes.

*Does not require additional hardware*

**WinPC-NC Light** is operating without any external hardware and is able to control a CNC machine or the drives directly by the controlling signals of the LPT printer port of the Windows PC.

Realtime abilities of **WinPCNC Light** however require a personal computer equipped with at least 1 Ghz clocking frequency and operating systems of Win2000 or WinXP.

By 3 stepper motor axes it is possible to realize any 2.5D mechanics and to use them for various functions. Standard applications contain:

- Drilling
- Plotting
- Grinding
- Dispensing
- Milling
- Cutting foils
- Engraving plates

*Extensive parameters*

The extensive range of options for setting parameters means the program can be adapted to almost all 2-3-axis machines.

*Clearly structured operator interface*

**WinPC-NC** offers a well thought-out and modern operating concept incorporating drop-down menus and a windows management system with mouse and keyboard operation. This makes it easy to learn and master the program.

*Runs on any modern PC*

All that is required for operating **WinPC-NC** is a commercially available personal computer with a hard disk, LPT printer port, any graphics card and MS-Windows 2000 or XP.






Sample of a 3 axis milling plant

### *Special features*

### **Special features of WinPC-NC Light :**

- 32-bit arithmetic for an almost unlimited working range
- according to industry standards it is controlling by clocking/direction signals any commercial stepper motor cards and producing stepping frequencies up to 12 kHz
- as an alternative a version for the commonly known SMC stepper motor cards is available, however with restrictions of the card itself
- jog mode in exact steps using the cursor keys or the mouse
- graphical display with scale, zoom, shift, turning and reflecting functions
- runs under Win2000 and XP without restrictions (date 6/06)
- axis resolutions, speeds, ramp length for the X/Y and Z-axis can be set within generous limits.
- reference and limit switch interrogation, max. 5 inputs and 4 additional outputs can be set within generous limits on LPT1
- recognizes the common available HPGL and drilling formats

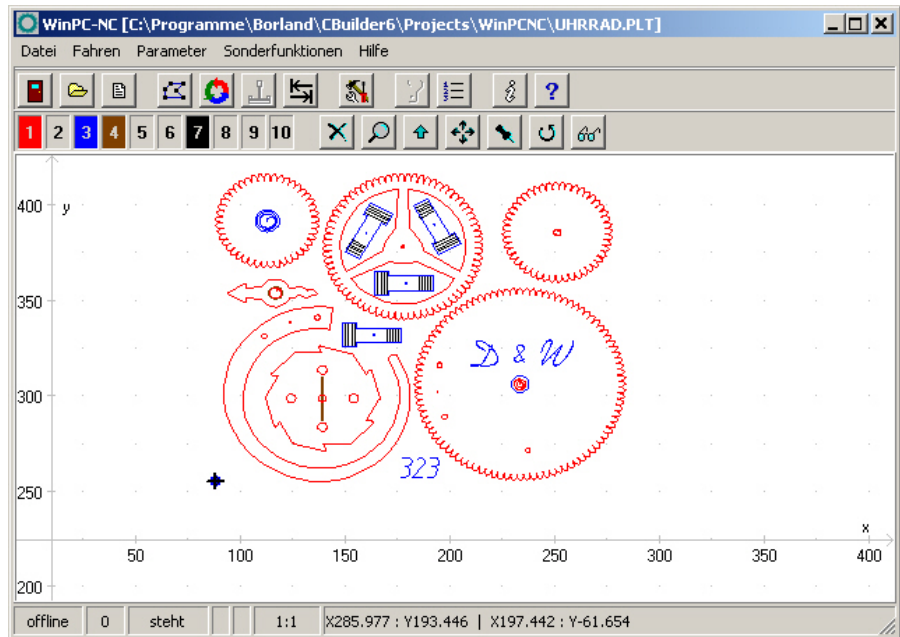

WinPC-NC main screen

- extensive tool management function, tools can be selected individually, colors can be set
- speeds can be set between 0.01 and approx. 1000 mm/s
- high-performance integrated editor
- lots of external signals for synchronizing the procedure, e.g. *start signal*, *machine ready* and much more
- units of dimension can be set to mm, inch and mm/s, mm/min and inch/min
- multilingual, other languages can easily be retrofitted, ger-eng-ita-turk-spa-port-pol (date 6/06)
- supports various additional signals and sensors
- ..there are many other features besides these

Also available  
for SMC800  
and SMC1500  
stepper motor  
cards



According to version **WinPC-NC Economy** is also available for the common SMC800 and SMC1500 stepper motor cards. When you order, please note that you have to indicate either clocking/direction or SMC version. Each version disposes of an individual motor signal, a reversal function of the program is not possible.

---

**Using the SMC version and a SMC800 or SMC1500 stepper motor card unfortunately there are not all functions available. This is due to the electrical and technical structure of the SMC cards.**

---

**Please consider the following restrictions with SMC stepper motor cards :**

- limit of the stepping frequency to max. 5kHz
- not more than 3 axes connectable
- all reference switches and additional inputs can only be connected to one input line on the card.
- further technical details can be obtained by the documentation of the SMC cards

---

## 2. First steps

---

### 2.1. Requirements to hardware

*WinPC-NC Light* is able to control a connected CNC machine and the corresponding drives directly by the LPT printer port. In order to make this procedure possible, a real time driver has been installed in the lowest plane of the operating system providing the necessary timers and mechanisms.

A faultless operation is therefore only guaranteed with Personal computers with certain minimum of requirements.

- modern CPU with at least 1GHz clocking frequency (more than 2 Ghz are recommended)
- Windows 2000 or Windows XP operating systems or succeeding models
- at least one true parallel printer port (onboard or by ISA/PCI plugin card)
- standard graphical card, keyboard, mouse, hard disk and other common PC implements

Detailed information and tips for selecting the suitable computer can be learned from further support information documents.

### 2.2. Possible restrictions during realtime operation

A reliable realtime operation under Windows depends on many different factors and can be affected by many running actions. Disturbances by other programs lead normally to an irregular and rough motor run. Sometimes it can happen that the machine will act completely uncontrolled.

*Please avoid  
background  
programs*

### **Ill effects concerning realtime ability...**

- access to hard disks, diskettes and network system as well as wireless system actions
- battery loading on notebooks or the constant monitoring and measuring of the battery capacity
- virus scan and firewall programs in the background
- Media-Player or other highspeed start-up programs awaiting in the background certain user actions.
- dynamic processor clock frequency changing functions like SpeedStep® or PowerNow®

In general it is recommended to remove or deactivate all programs which are not required. Notebooks often cause much more problems than desktops computers because the essential signals of the printer port often do not meet the electrical requirements.

Detailed information and tips for selecting the suitable unit are given with additional support information.

## **2.3. Installation**

*User-friendly  
installation*

**WinPC-NC** is installed using a user-friendly setup program. Please insert the disk into the drive and wait for automatic installation start. If the installation is not executed, please start the program SETUP.EXE directly from the CD. The installation wizard then guides you through the entire procedure.

Call up the **README** file to learn about important changes to the information in the manual. These changes are additional features included after the manual was written.


*List of files*

**The following files are installed to the target directory :**

<b>WINPCNC.EXE</b>	Control program
<b>WINPCNC.WPI or WTI</b>	Parameter file
<b>WINPCNC.WPW or WTW</b>	Tool file
<b>WINPCNC.HLP</b>	Help texts
<b>WINPCNC.LNG</b>	Messages and texts, multilingual
<b>WCNCCON.DLL</b>	Realtime driver
<b>README</b>	Latest changes to the manual
<b>*.DLL</b>	Some files needed in the system folders
<b>*.PLT *.SMM *.DIN</b>	Sample NC files
<b>*.NCP *.EPS</b>	

## 2.4. Launching the program

**WinPC-NC** is launched simply by clicking the desktop icon or by means of the start menu. After a short time the window of the realtime module appears in the upper left corner of the screen and in the middle the **WinPC-NC** working screen which is divided into several areas.

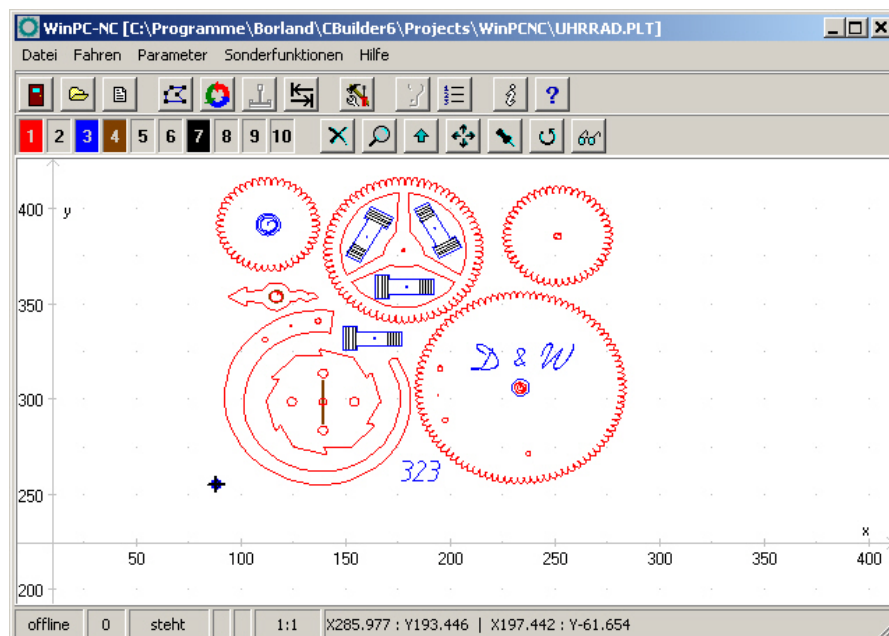

*WinPC-NC screen layout*


- Title bar
- Menu bar
- Bar with speed buttons
- Toolbar and display buttons
- Display area
- Status bar

### *Screen layout*

The title bar and menu bar are located at the top edge of the screen. The drop-down menus open from the menu bar.

The quick speed buttons enable you to select important functions simply by clicking with the mouse.

The function of the individual buttons is as follows :

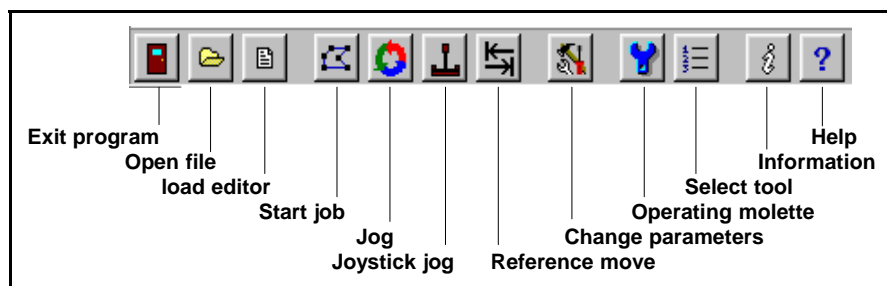

Speed button bar in *WinPC-NC*

The status bar at the bottom displays information about the operating status of the software and the machine, or else a help text about the functions which are currently active. Buttons for operating the display and the tools are located in the second button bar.


The large area is the working area where *WinPC-NC* displays the currently loaded NC file in graphical format.

*Realtime module with own window*

Actual data information and status are displayed by the realtime module on the left top edge.

The used realtime module displays the version and serial number. Furthermore it can be observed by T/R or SMC whether motor controlling takes place with the clocking/direction or SMC signals.


A message is displayed if the realtime driver has loaded correctly and is running without restrictions.

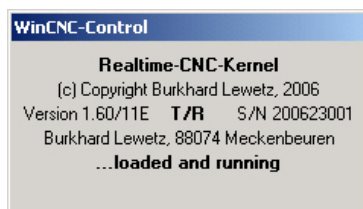

Display of the realtime module

## 2.5. First setup and test moves

Executing an initial test run with the motors there is nothing else to do than connecting the machine with the LPT port and checking or amending the occupation of the controlling signals.

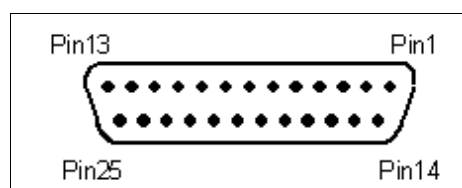

LPT port, pin layout

**WinPC-NC** is using the following signals for motor actuation...

Pin 2 direction motor X  
 Pin 3 clock motor X  
 Pin 4 direction motor Y  
 Pin 5 clock motor Y  
 Pin 6 direction motor Z  
 Pin 7 clock motor Z  
 Pin 8 direction motor 4  
 Pin 9 clock motor 4




**Using a SMC steppermotor card it is not necessary to consider the exact signal assignment. It is sufficient to utilize a commonly used printer cable for connecting LPT port and SMC card.**

In order to detect the LPT port address you have to call up the device manager in the system control.

**Please perform the following steps...**

- open the device manager under *My computer, control panel system, hardware*
- open the category *ports COM & LPT* and select the LPT port which is connected to the machine
- select by the right mouse button the function *properties* and then *resources*
- note the port address under which the LPT port is registered in the system. With onboard ports it is usually the port address 0378hex.

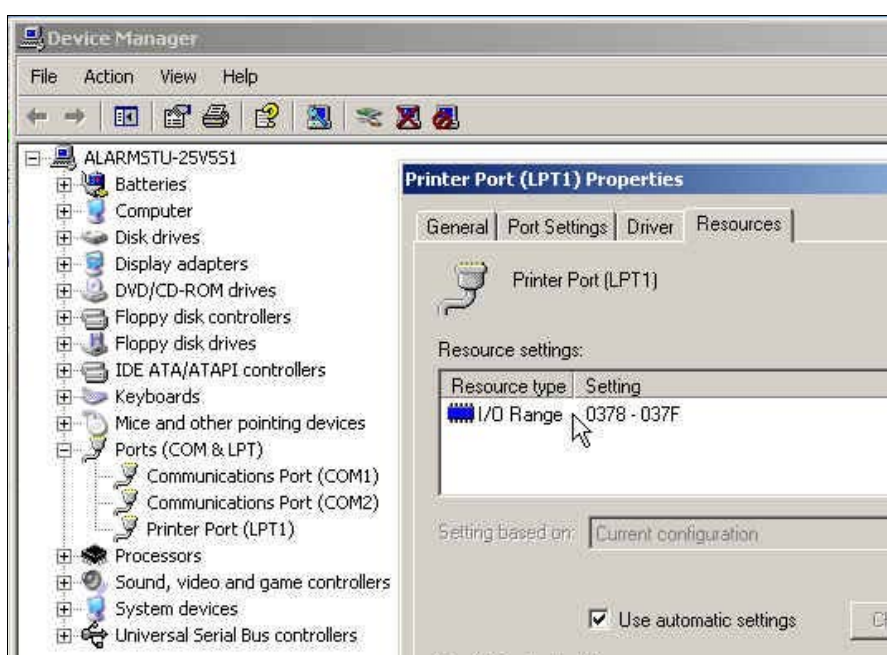

Locating the LPT port by means of the device manager



The detected port address has to be registered in **WinPC-NC** under *parameter-ports- LPT.port address* and complete the process by clicking the function keys *SAVE* and *OK*.

After this procedure it should be possible to perform a simple test run with function *JOG* or *MOTOR TEST*. Please be very careful in performing and be aware of uncontrolled movements of the machine.



---

**When first delivered, the LPT port address is registered with 0378hex. This applies for nearly all internal ports.**

---

Detailed instructions concerning start-up procedure are given in a separate chapter.

## **2.6. Exiting WinPC-NC**

You can exit **WinPC-NC** at any time by clicking the cross in the box at the top right of the window, or by selecting *EXIT* from the *FILE* menu.


## 3. Operating WinPC-NC

### 3.1. Graphical display of the NC file

*Graphical preview of the NC files*

The graphical preview function in **WinPC-NC** is activated as soon as an NC file is selected. All contours or vectors can be seen in the tool color.

In addition, two rulers can be seen with the current dimensions and positions. The workpiece zero point is identified by a small black dot and the current machine position as a small red dot.

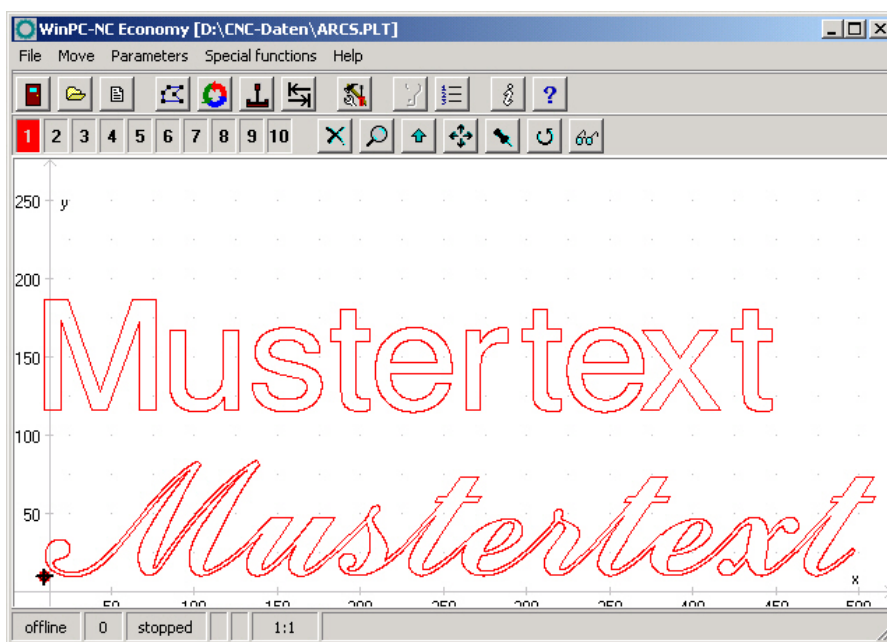


Graphical display of the NC file

**The following actions are possible on the graphical display :**



#### Zoom

With the zoom function, it is easy to view certain sections of the screen in a magnified view. After you select the function by clicking the zoom button, the cursor appears as a cross and you can click and drag a rectangle to select the required area.

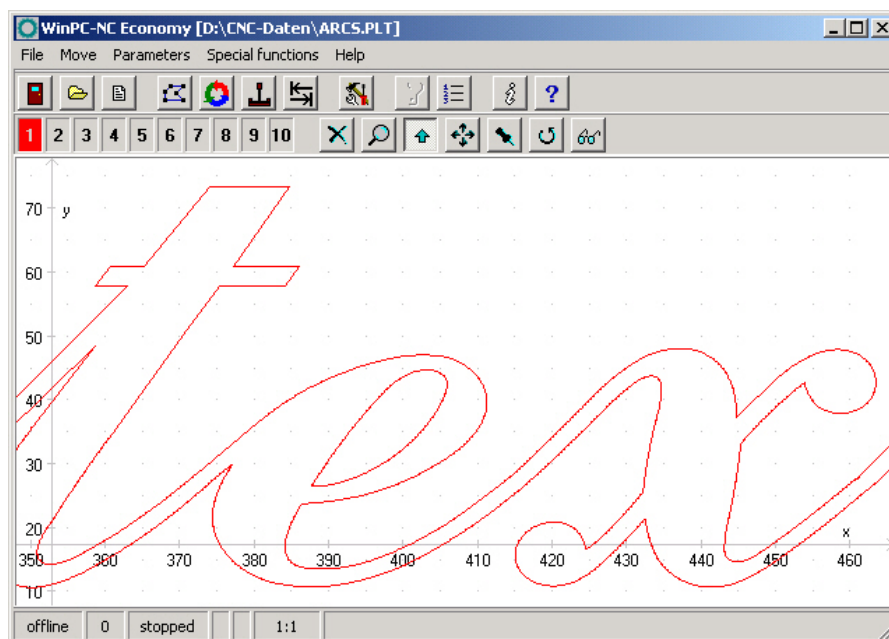

Zoom in the graphical display of the NC file



### Move

The move function makes it possible to use the mouse to move a zoomed image and enables you to view another part of the NC file in greater detail. After the function has been activated, the cursor appears as a hand. With it, you can click and drag any point to move the image to where you want.

The movement track is displayed as a line while you are dragging. Once you release the mouse button, the graphic appears in the new position to where you have moved it.



### Display original size


Clicking this symbol restores the original size and position. This undoes all zoom and move actions.



### Define current machine position

The current machine position is represented by a small red dot in the graphic. Using the function described here, you can position the NC file in the way that the current machine position corresponds exactly to a point or a certain position in the file. The file zero point is simply recalculated internally.

Using this method it is quite simple to position the workingpiece and the NC file with great accuracy.

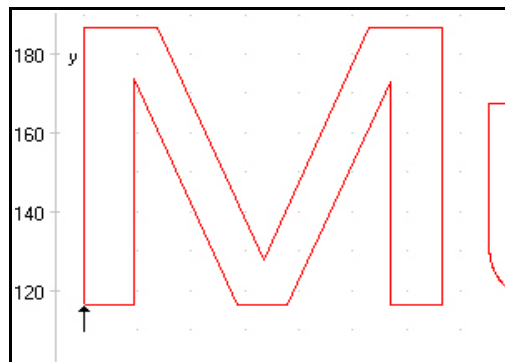



### Cancel function

Once a zoom, move or positioning action has been started, it can be cancelled by clicking the cancel button. The cursor reverts to its normal arrow shape.




### Turning data

By clicking the *TURN* button it is possible to turn the indicated data by 90°. In this way it is easier to place the data on the material.



### Selecting the display area

By means of the button *AREA* the graphical display can easily be changed. So it is possible to display only the piece to be produced and its corresponding data. There is also the possibility to display the defined workpiece area or the stipulated machine size with the current position. In this way it is easy to recognize the location of the piece and whether it can be worked without any problems within the defined limits.

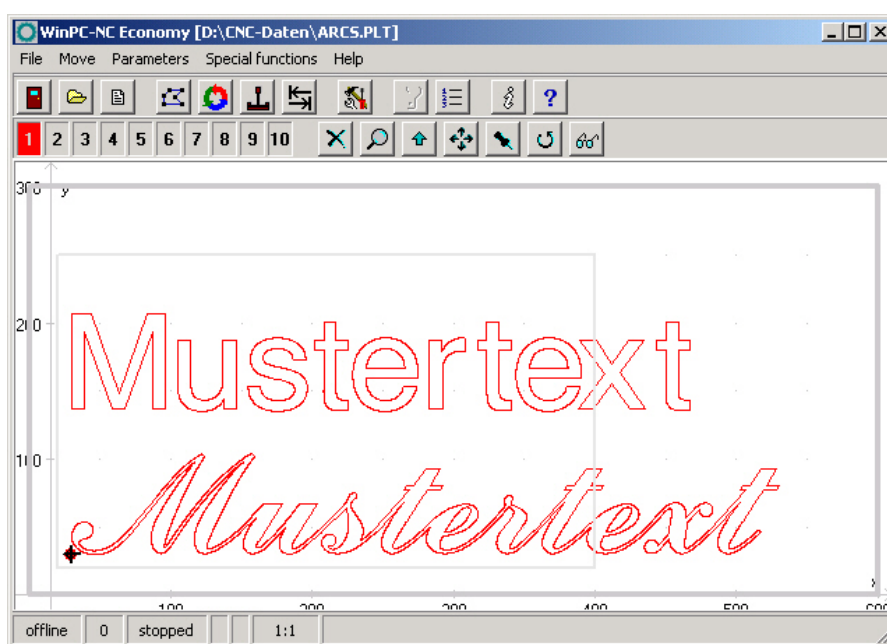


Display with machine table and working area



### Set tools active/inactive

All tools which are used in an NC file are displayed along the lefthand edge in the tool frame. They are shown using their current colors. A tool can be deactivated or activated simply by clicking the tool box. Switching in this way has the same effect as activating it in the parameters. Once tools have been switched, they immediately appear in the graphical display.

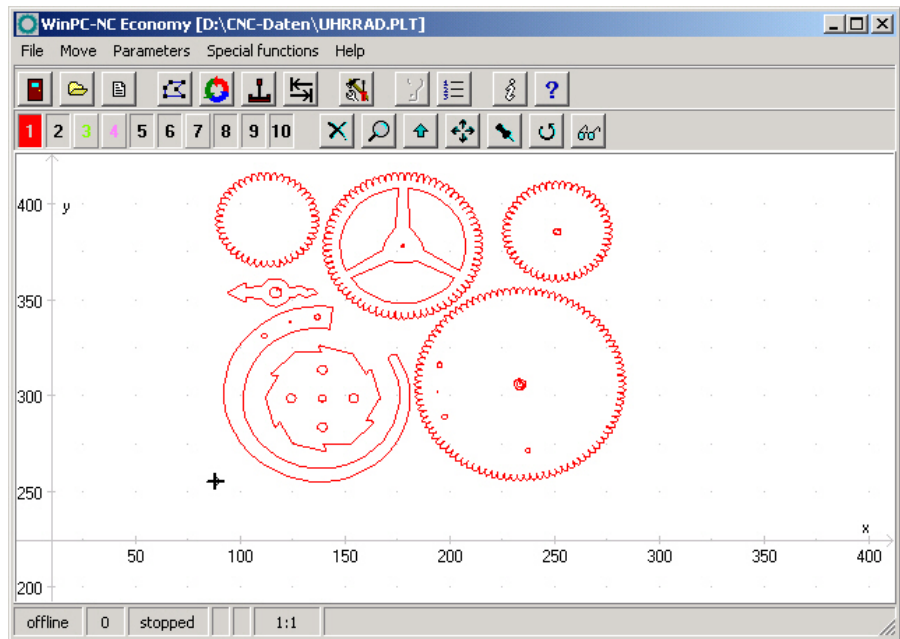

Graphical display with inactive tools

### 3.2. Drop-down menus and function keys

#### *Modern interface*

**WinPC-NC** has a modern user interface. All functions can be activated by drop-down menus. In addition, frequently required functions can be activated quickly using the function keys or speed buttons.

The drop-down menus are divided into several functional groups, e.g. all functions concerned with selecting and editing files are grouped together in one menu. All parameters and tools are set using another menu.

The menu system is opened or activated by clicking the menu item or pressing one of the shortcut keys for the individual menus.

#### *Additional function keys*

Important functions can also be activated using function keys. The function key assignment is fixed and indicated in the menu functions.

#### **The most important function keys are :**

(F1)	Activate the help system
(F2)	Load new NC file
(shi ft-F2)	Load parameter file
(F3)	Start job process
(F5)	Jog
(shi ft-F5)	Joystick jog
(F7)	Load active or new file into the editor
(F8)	Start reference move

### 3.3. The individual menus

The following text describes all the menus and functions in detail.

Not all menu items are active all the time. Functions are sometimes unavailable, depending on the program status. For example, it is not possible to use the joystick if it has not been defined in the parameters.

#### 3.3.1. File menu

The FILE menu combines all functions used for selecting files to process and analyse them. In addition, it is also possible to exit *WinPC-NC* here.


Open	F2
Open without parameters	
Editor	F7
Exit	

Press the (alt-D) shortcut key to open the file menu.

### FILE-OPEN

*File selection  
by menu*

The FILE-OPEN menu item calls up an interactive function for selecting a NC file.

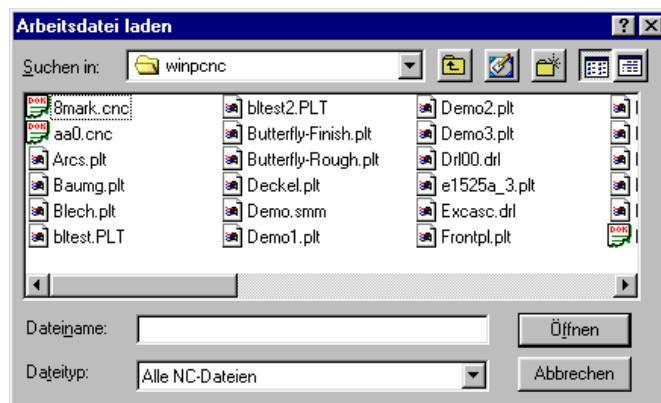

File selection dialog box



In the dialog box, it is possible to change drives and folders, as well as to activate filters for certain file name extensions. The file selection function can also be activated using function key (F2) or by clicking the open button.

*Graphical preview  
of an NC file*

The graphical preview function in *WinPC-NC* is activated as soon as it is selected. All contours or vectors can be seen in the corresponding tool color.


## FILE-OPEN WITHOUT PARAMETERS

The second *OPEN* function only loads the corresponding NC file without taking account of any project parameters. All current parameter settings remain valid.

## FILE-EDITOR

*Revising  
NC data*

The *EDITOR* menu item activates the editor for creating or revising the NC files.

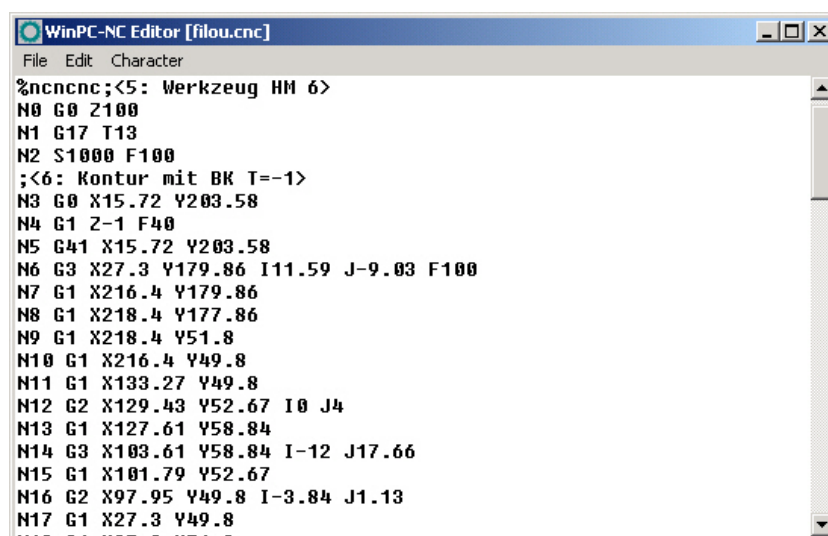

NC file in the integrated editor



The editor can also be activated using function key (F7) or by clicking the editor button.

## FILE EXIT



You can select the FILE EXIT menu item to exit **WinPC-NC**. Clicking the exit button has the same effect.

### 3.3.2. MOVE menu

*Functions for  
moving the  
machine*

The *MOVE* menu groups together all functions which are used for controlling the machine and the tool changing.

<b>Start</b>	<b>F3</b>
<b>Jog</b>	<b>F5</b>
<b>Joystick jog</b>	<b>shift-F5</b>
<b>Reference move</b>	<b>F8</b>
<b>Select tool</b>	

Press the (Alt-F) shortcut key to open the menu.

## MOVE-START




After a working file has been loaded, the *START* menu item can be used for processing the job. Pressing the (F3) key or clicking the *START* button has the same effect.

*WinPC-NC* controls the X and Y motors during move commands. The Z motor moves up and down during tool movement commands.

### Progress display

During machining, a window displays the progress as a percentage. In addition the realtime file display is available where the current performed command line is marked by a cursor bar.

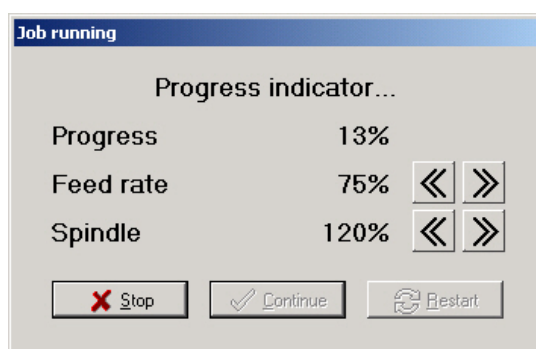

Display of progress and speed override


A working process can be cancelled by clicking the *STOP* button in the progress display window, or by pressing the (ESC) key. The machine brakes all axes without losing any steps and switches off the spindle and the cooling function.

## MOVE JOG



The *JOG* menu item calls up the manual setup function for the machine. This function can also be accessed by pressing the (F5) function key or with the jog button.



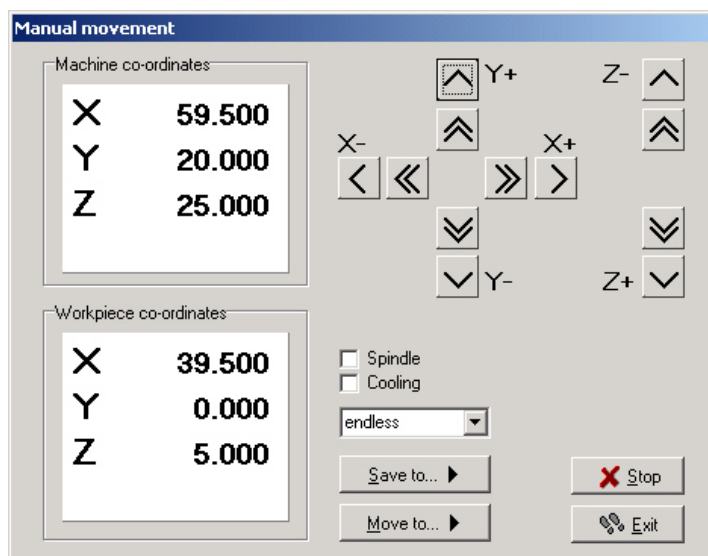

Jog function

*Exact movement with the keyboard or mouse*

In *JOG* mode, it is possible to move all motors step-by-step or continuously with the white arrow keys or with the mouse. Pressing a key briefly or clicking the corresponding direction button causes only one motor step to be performed. Pressing the key for longer or keeping the mouse button pressed causes the motor to move continuously. The changeover time can be defined as a parameter.

Only slow movements are possible using the PC keyboard, whereas with the mouse the double arrow buttons can be used for fast movements and the other buttons for slow movements. The speeds are defined in the parameters.

*Display of the step counter*


The absolute step counters for each axis are displayed in the top part of the window. Their values relate to the reference point on the reference switches. Below them are located the relative step counters which relate to the zero point of the working piece.





---

**WinPC-NC distinguishes between two systems of coordinates. Firstly the machine coordinates with their origin on the reference switches and which are referred to as the reference point. Then there are the workpiece coordinates with the workpiece zero point, which is usually located in the bottom left-hand corner of the data area.**

---

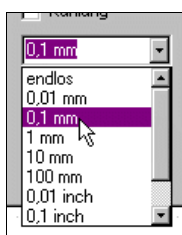


**WinPC-NC** can move the axes endlessly, i.e. movement continues for as long as a key remains pressed. The axis brakes when the key is released and comes to a stop without any step losses. The second possibility involves moving discrete distances. Distances between 0.01mm and 100mm are possible, as well as inch dimensions. The currently set distance is displayed in the window. **WinPC-NC** moves this distance in any required direction and with both possible speeds, depending on which button or key is pressed.

 

In addition to the predefined distances, it is possible to enter any distance in the text box.

### Switching additional signals

Clicking the check boxes with the mouse is all that is required to switch the additional signals *drilling spindle* and *coolant pump*. This switches the signals on or off. Both signals are switched off when you exit the *JOG* function.

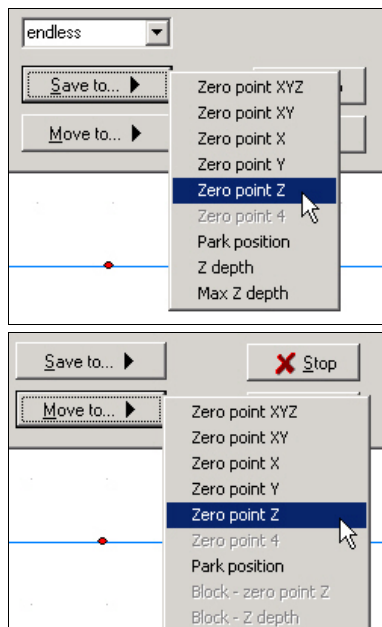

During manual movement, it is possible to move and store certain help points. After a position has been reached, it is easy to click the *Save* button to select the required point and save it permanently as a parameter.

Moving to saved help points is just as straightforward. All that is required is to click the *Move to* button and select the required help point. Then the machine moves to it.

Movement in progress can be interrupted at any time by clicking the *Stop* button.

The *JOG* function can be exited by clicking the *Exit* button.

## MOVE JOYSTICK JOGGING



As an alternative to the mouse and keyboard, it is also possible to move the machine manually using a connected joystick. This is of advantage for observing the movements directly on the machine and setting exact positions. It is easier to take a joystick to the machine than keyboard or mouse.




**Prior to use a connected joystick it must be configured in the Windows system and calibrated with a special function.**

### Jogging with joystick

When setting up the machine with the joystick, movement in the X and Y-axis directions can be achieved simply by tilting the control handle. Moving the Z-axis requires pressing joystick button 1 as well.

A help point can also be stored directly at the machine using the joystick. The stored position can be selected by repeatedly pressing joystick button 2. To store the position itself, press button 2 at the same time as holding button 1 pressed.

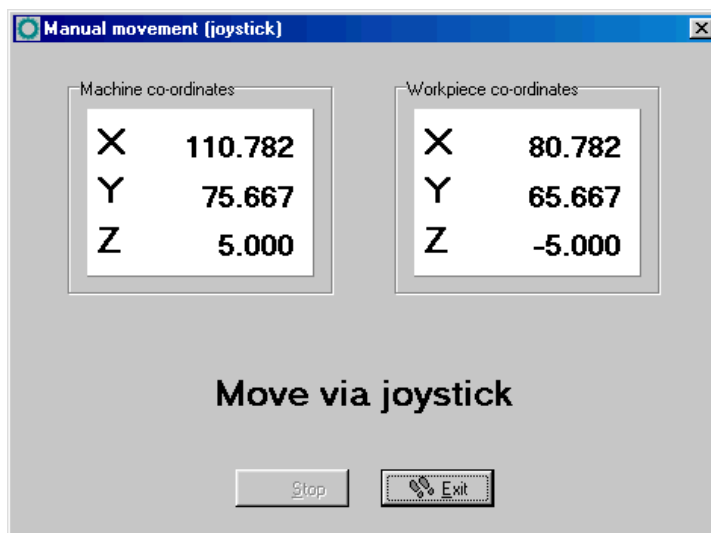


Manual move with joystick

## MOVE-REFERENCE

The function *REFERENCE MOVE* also called homing runs all axes to the reference switches in a defined sequence.

*Reference point of the machine*

Every axis starts moving at reference speed 1 and searches for the reference switch of the machine. Movement stops when the switch changes its level. Then movement starts at speed 2 in the opposite direction back away from the switch. The edge of the reference switch defines the reference point for this axis.

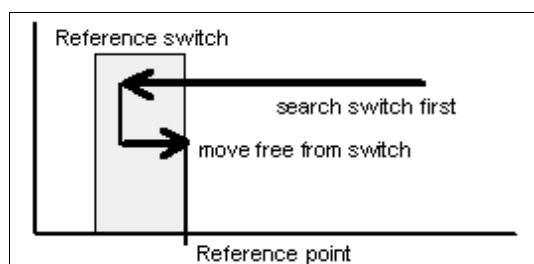

Sequence of reference movement to the reference switch

**WinPC-NC** needs to know the current positions of all axes. As a result, reference movement is essential before a working process.



Reference movement is also triggered by pressing the (F8) key, or using the *reference* button.

## MOVE-SELECT TOOL...




There is a special dialog box for controlling the tool change or if tool length measurement is activated. It can be activated using the menu function or the *tool list* button.

The dialog box contains the following possible functions :

- Place an inserted tool in the magazine
- Pick up a new tool
- Measure the length of a tool
- Identify the tool which has just been inserted

As a rule, **WinPC-NC** always remembers which tool was used last and the status of the collet chuck. As a result, this information is retained over more than one session.

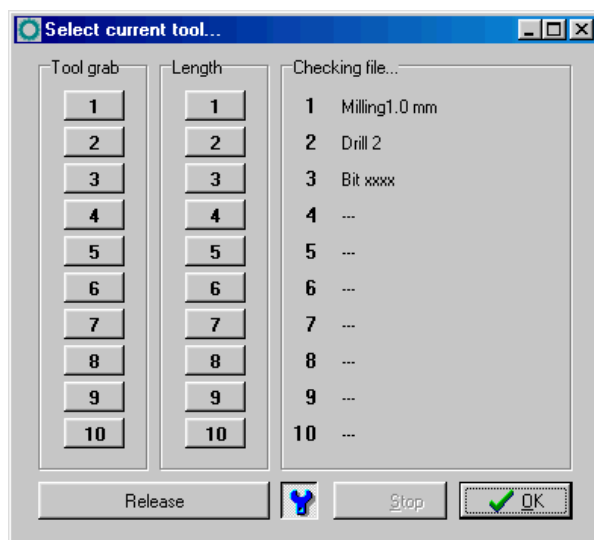

Dialog box for selecting, picking up, putting down and measuring tools



To inform **WinPC-NC** which tool is currently inserted, all you have to do is click the tool number or name on the right. This may be necessary after the initial startup or following a cancel.

### 3.3.3. PARAMETERS menu

The PARAMETERS menu contains all the setting options for **WinPC-NC**. It is made up of several dialog boxes which contain the parameters grouped by function.



The shortcut key for activating the *PARAMETERS* menu is (Alt-P) . Clicking the *parameters* button has the same effect. The individual parameters are explained in detail in a subsequent chapter.

## PARAMETER-SAVE

*Saving parameters specifically for a project*

All parameter and tool settings can be stored in files using the *SAVE* menu item. It is possible to save the settings for a working file or for a project.




The *Save* function operates as follows : When a working file is loaded, **WinPC-NC** stores all workpiece-related settings such as the zero point, scaling, etc. in a parameter and tool file associated with the working file. The files have the same name as the working file, with the endings\*.WPI and \*.WPW, z.B. HOLDER.WPI or ENGRAVING.WPW.

Whenever these working files are loaded in the future, all the settings and tools are once again available without having to be redefined.

The machine-related parameters such as axis resolution, reference directions or the interfaces used are always stored in the standard parameter file WINPCNC.WPI.

If no working file is selected when you save, the *Save* function stores all settings in the default files WINPCNC.WPI and WINPCNC.WPW.

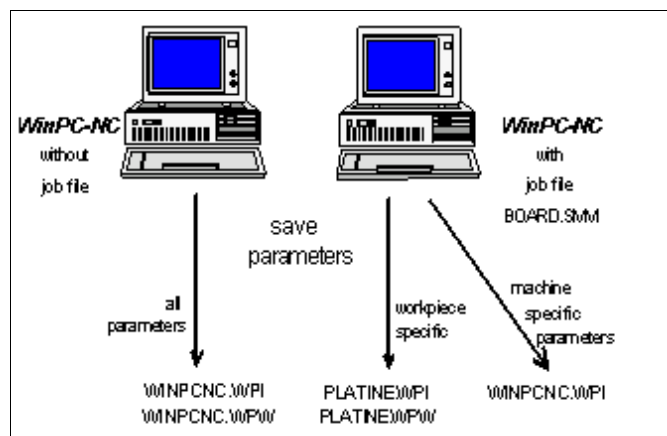

Saving parameters and tool settings

Subdividing between two parameter files offers the advantage that all machine parameters only have to be saved once, and they only have to be saved in this file whenever changes are made.

## PARAMETERS-SAVE AS...

The second *Save* function allows you to enter any file name for the project parameters. In this way it is possible to produce parameter settings for various operating procedures or materials.

## PARAMETERS-LOAD...

*Loading specific parameters records*

The *LOAD* function enables you to load various specific parameters, e.g. for different materials or working processes.

A window appears with the familiar *open* dialog box functions. It is possible to select parameter or tool files.

The *PARAMETERS-LOAD* function can also be activated with (Shift-F2).


### 3.3.4. SPECIAL FUNCTIONS menu

The *SPECIAL FUNCTIONS* menu gives you access to two test functions which you can use to systematically check the mechanics and to ascertain what are the correct or optimum parameter settings. Also, a joystick calibration function and a position check function are integrated here.

Signal test  
Motor test  
Status information  
Joystick calibration  
Check position

## SPECIAL FUNCTIONS-SIGNAL TEST

This test function can be used for checking the axis inputs of the controller, i.e. the limit and reference switches, as well as the outputs.

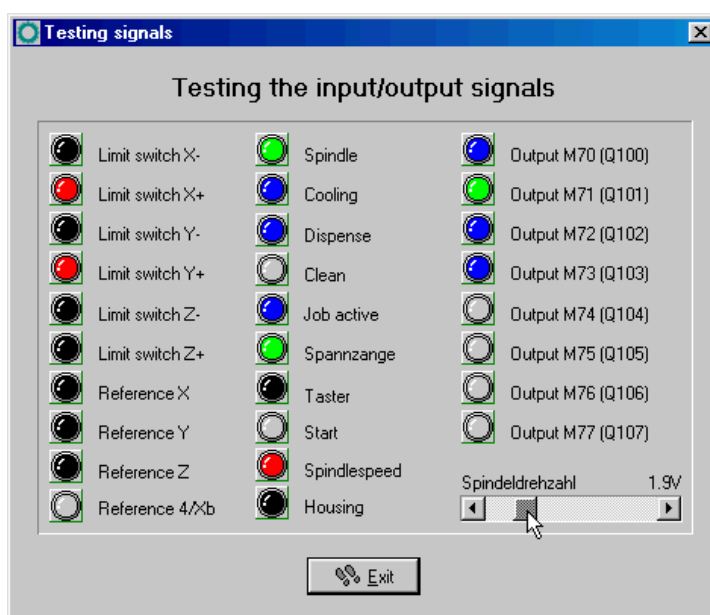

Signal test

*Interactive  
testing of all  
inputs/outputs*

**WinPC-NC** continuously interrogates the limit switches and reference switches on all supported axes and displays their status. Grayed out switches are not defined.

Black indicates the switch is not active, while red displays that the switch is activated.




**Definiton of the switches and setup of the switching logic must be executed during installation by the signal wizzard under *parameter-machine-signals*.**

The supported additional signals are tested by simply clicking the LED symbols. This switches the outputs on or off.


## SPECIAL FUNCTIONS-MOTOR TEST

The *MOTOR TEST* special function is used for ascertaining the optimum speed settings. A window displays all parameters relevant to the step calculation.

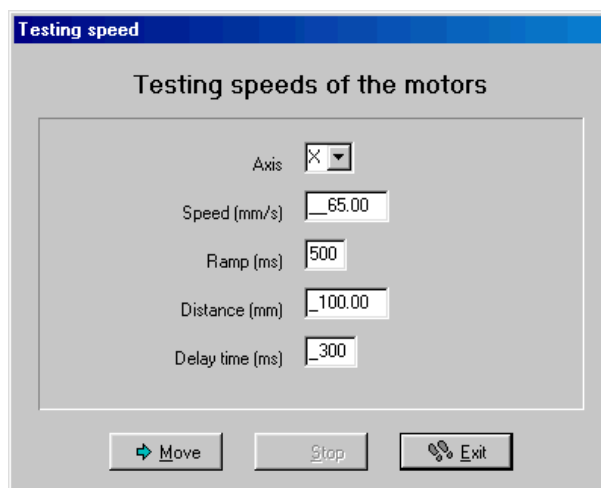

Motor test

 The required values can be entered in the parameter boxes, after which a test run can be performed immediately in order to check all parameters.



Clicking the *Move* button causes **WinPC-NC** to move the selected axis continuously forwards and backwards. By listening to and observing the movement, it is easy to tell whether the parameters are correct for the axis, or whether additional corrections are needed to the speed or ramp length. The test run is cancelled by pressing the (ESC) key or clicking the *Stop* button.

### *Optimum parameters*

The optimum values for an axis have been achieved if the motor starts up quickly without step losses, and is still able to develop sufficient torque at maximum speed.

### *Step-by-step setting*

#### **Step-by-step procedure for testing X/Y and Z-axis :**

1. Switch off the ramp length and slowly increase the start/stop speed until the motor stalls. Then reduce the speed value by 30-40%.
2. Test the ramp length with various values. You have achieved a good value if the motor starts up quickly without stalling.
3. Increase the rapid speed in stages. The motor should run quickly while still developing sufficient torque.

Having ascertained the values, you can store them as parameters for the axis in question. All parameters and their functions are explained in a subsequent chapter.






The optimum parameters for a stepper motor axis depend on many factors, e.g. the motor characteristic, the type of drive used (spindle or belt) and the load to be moved.

## SPECIAL FUNCTIONS-STATUS INFORMATION

*Informationen  
about the  
realtime module*

**WinPC-NC Economy** works only in conjunction with the realtime module WCNCCON.DLL. The special function *Status information* reads out and displays the version and serial number of it.

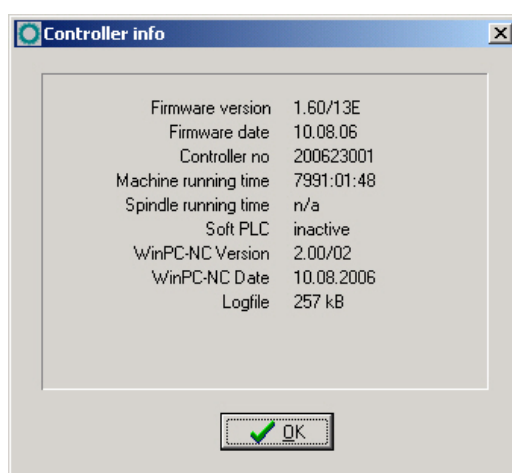

Display of the realtime module version

Whenever you have any queries for the manufacturer, always provide the version number of the realtime module and the controlling number as well as the version of **WinPC-NC**.

## SPECIAL FUNCTIONS-JOYSTICK CALIBRATION


To be able to move the machine with a joystick, **WinPC-NC** needs to know the type and value ranges of the joystick signals. The *JOYSTICK CALIBRATION* function does this almost automatically.

*Determination  
joystick para-  
meters menu*

Instructions for operating the joystick are displayed in a window. Please follow these instructions exactly. The procedure involves pressing both buttons and moving the lever to certain positions.




The joystick cannot be used before it has been calibrated.

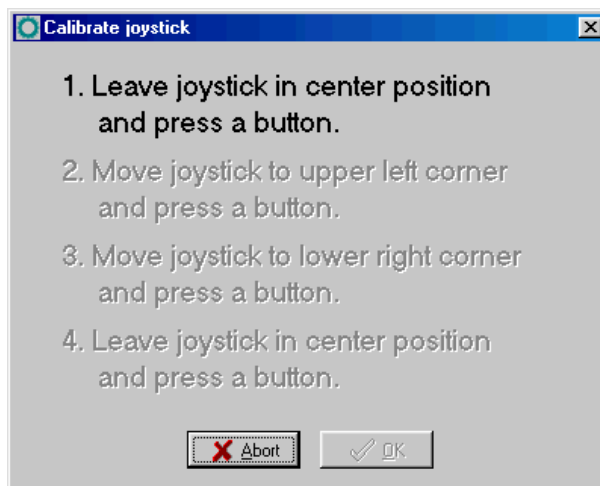

Joystick calibration

## SPECIAL FUNCTIONS – CHECK POSITION

The *CHECK POSITION* function is another test function in **WinPC-NC**. It can be used for checking the accuracy of the reference switches.

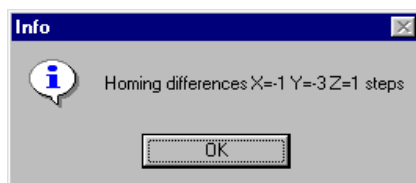

Result of the position check

### *Check reference position*

Relatively small step discrepancies may be due to the switches. Large discrepancies, on the other hand, indicate previous step losses.

**It is a good idea to use the CHECK POSITION function if:**

- you presume steps have been lost due to a collision
- you want to determine the maximum machining speed for a tool or a material, which means you want to demonstrate whether or not steps have been lost
- the position was changed during a tool change




---

**It is only possible to check the reference position if reference movement was performed previously and there was no cancel due to a limit switch or a stop signal.**

---

### 3.3.5. HELP-menu

There are three items in the help menu:

Help topics...
Liability
About WinPC-NC

## HELP-TOPICS


The *HELP TOPICS* function gives you access to the help system. A dialog box appears containing the main selection.

## HELP-LIABILITY

The *HELP-LIABILITY* function displays a text with the license conditions and a disclaimer. Please read this information carefully before using **WinPC-NC**.

## HELP ABOUT WinPC-NC

Activating this menu function displays information about the current version and revision number.

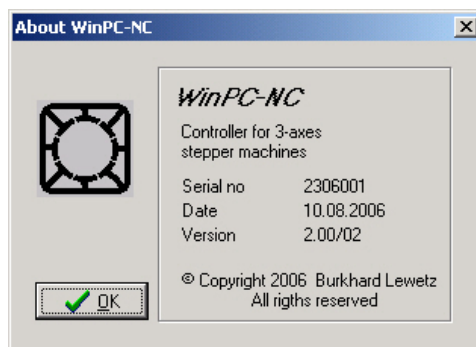

Information about the current version


## 4. Parameter settings

### 4.1. Tool management

*Project-related  
tool management*

**WinPC-NC** has a user-friendly *tool management* function. It is possible to define up to 10 tools with specific values for each working project.

The parameters are divided between several dialog boxes. **WinPC-NC** stores all the values defined in these dialog boxes into the tool file using the PARAMETERS-SAVE menu function. Tool files have the \*.WPW filename extension.

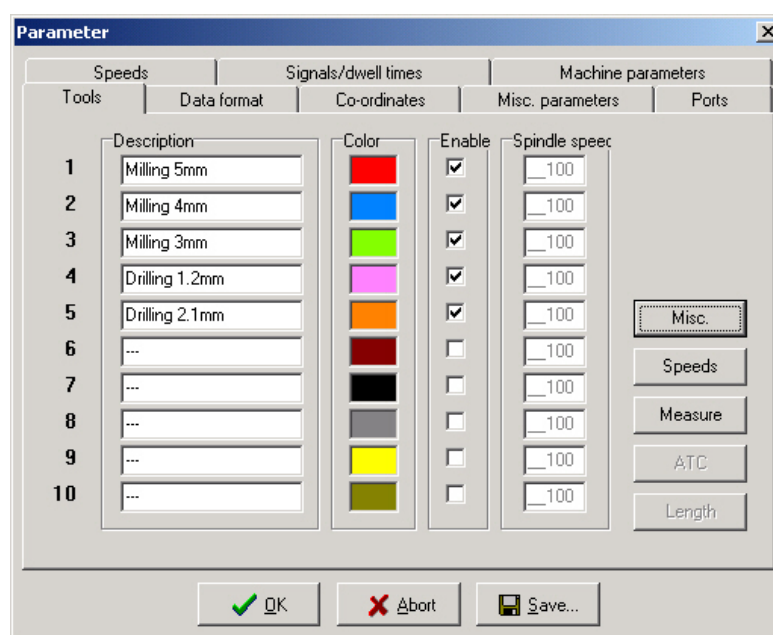

Tool management (window 1)

### Designation

*Meaningful  
tool names*

Each tool is identified with a name which is used during tool change prompts.

## Color

*Colors in the graphical display*

The *Color* parameter for each tool is used in the graphical display of the data. As a result, it is easy to adapt the color display to suit your own requirements or to harmonize with the CAD program you are using.

Clicking the colored box opens a dialog box in which you can select a new color. All colors supported by the current Windows display settings can be selected.

## Activation

*Activating tools individually*

Each tool can be individually enabled or blocked. Inactive tools are simply ignored in the graphical display and the commands for them are skipped.

## Tool speeds

Tools	V-Plunge	V-Advance	V-Withdrawal	Brake ang
1	5.00	20.00	10.00	30
2	6.00	22.00	10.00	30
3	6.00	10.00	10.00	30
4	1.00	5.00	10.00	30
5	1.00	5.00	10.00	30
6	1.00	5.00	10.00	30
7	2.00	10.00	10.00	30
8	1.00	5.00	10.00	30
9	5.00	5.00	10.00	30
10	5.00	5.00	10.00	30

Tool management (window 2)

## Plunge speed

The plunge speed specifies the speed with which each tool is pushed into the workpiece. It is necessary to consider certain limit values here, depending on the material and the tool.

## Advance speed

The advance speed or feed rate defines the working speed for each tool when the tool is pushed into the workpiece.

This value is irrelevant for straightforward drilling applications. However, if **WinPC-NC** is used for milling, engraving or grinding, then the maximum feed rate depends on the tool used and the material.

## Withdrawal speed

The withdrawal speed is used for raising or withdrawing the tool from the workpiece.


## Brake angle

The brake angle specifies the maximum angle differential for subsequent movement stages in which movement takes place at full speed. The value is entered in degrees.

### *Deterministic speed optimization*

Between the start and finish of movements, the acceleration and braking function is only activated if the direction of the next vector deviates from the previous one by more than the defined brake angle.

An example of this deterministic speed optimization function can be seen in movement around a circle, which consists of lots of little individual vectors. The directions of two successive movements are only slightly different. As a result, the circular path can be moved in one operation at maximum speed.

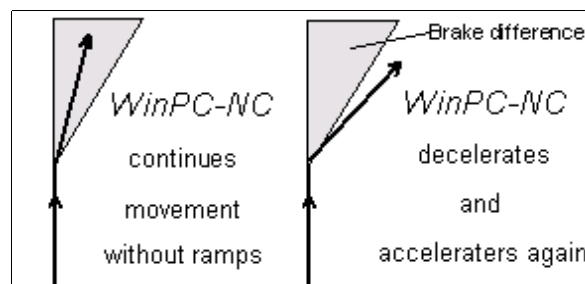

Brake difference

Braking and acceleration always take place before and after tool movements. This parameter is irrelevant in straightforward drilling applications and is ignored.

## Tool dimensions

Tools	Depth	Repetitions	Z feed correction
1	3.40	0	0.00
2	3.70	0	0.00
3	0.60	0	0.00
4	5.00	0	0.00
5	5.10	0	0.00
6	5.32	0	0.00
7	6.00	0	0.00
8	1.00	0	0.00
9	1.00	0	0.00
10	1.00	0	0.00

**Tool measurement**


Misc.  
Speeds  
**Measure**  
ATC  
Length

OK Abort Save...

Tool management (window 3)

## Plunge depth

The plunge depth specifies the distance by which the Z-axis of each tool is moved downwards into the workpiece. The depth is defined in millimeters and is always measured starting from the plane of the zero point.

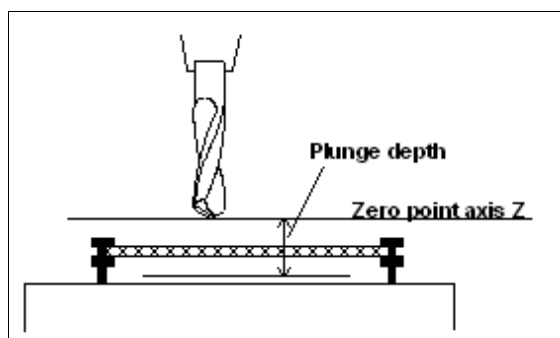

Plunge depth measured from the zero point of the Z-axis

## 4.2. Speeds

All the parameters which control the speeds of the motors are grouped together in the *Speeds* dialog box.

The optimum parameter values for the required speeds can be determined using the *MOTOR TEST* function.

All parameters must be set separately for X, Y and Z. This means the correct speed can always be calculated and used, even when different axis resolutions are involved.

	X	Y	Z	
Rapid speed	20.00	20.00	7.50	mm/s
Manual speed, fast	20.00	20.00	7.50	mm/s
Manual speed, slow	2.00	2.00	1.00	mm/s
Reference speed, search	15.00	15.00	7.50	mm/s
Ref. speed, moving free	1.00	1.00	1.00	mm/s

Changeover time: 200

Spindle speed, default: 12000

Reset speed override at...

OK Abort Save...

Speeds parameter

## Rapid speed

*Speed with the tool raised*

Rapid speed is used for moving to a new position with the tool lifted out of the workpiece.

These are unproductive movements which **WinPC-NC** always moves at the fastest possible speed.

## Manual speeds

These parameters specify the speeds during jog mode. Two speeds can be defined.

*Individual steps or continuous movement*

The motor changes over to continuous movement if the key or the mouse button is pressed for a longer time. It moves at the speeds defined here in this case.


It makes sense to use fast speed to traverse long distances, while exact positioning is facilitated with slow speed or single steps.

## Reference speeds 1/2

In reference movement, each axis starts moving at speed 1 and searches for the reference switch.



The axis is braked when the switch changes the level, at which point the axis moves in the opposite direction away from the switch at speed 2.

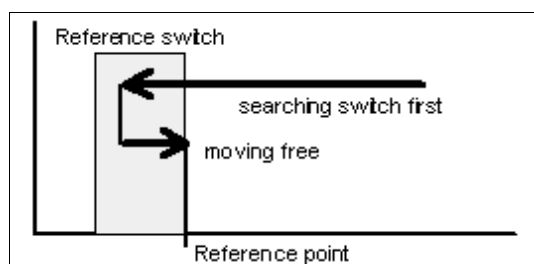

Reference movement of an axis

*Reference point of the machine*

The edge of the reference switch defines the absolute machine zero point or reference point for this axis. A low value should be specified for speed 2 so the movement ends with the shortest possible ramp when moving free.




---

**WinPC-NC distinguishes between machine coordinates (with the reference position as their origin) and workpiece coordinates with the workpiece zero point.**

---

## Changeover time

The changeover time defines the delay for the transition from single step to continuous movement in *jog mode*.

**WinPC-NC** outputs individual steps to the motors every time one of the cursor keys is pressed briefly or the mouse button is used to click one of the movement buttons once. If one key or button remains pressed for a longer time, that is the changeover time, the motor changes to continuous movement and is not stopped until the key or button is released.

## 4.3. Coordinates

In the *Coordinates* dialog box it is possible to define all parameters relating to dimensions, help points and the unit of measurement.

Setting the working area and the help positions

### *Machine and workpiece coordinates*

It is necessary to distinguish between two types of position definitions. There are absolute machine coordinates with their zero point at the machine reference point. Then there are workpiece coordinates with their origin at the workpiece zero point.

## Working area and monitoring working area

### *Software area monitoring*

The working area defines the section, e. g. for marking material dimensions. Limits are visible in the graphical display and it is immediately recognizable whether milling or engraving can be effected with the material piece. A check is made when job starts.

### *Maximum plunge depth for Z-axis*


The working area for the Z-axis determines the maximum plunge depth to which tools can move without damaging the bed of the machine.

These parameters are not to be mixed up with the values determining the size of the machine table and thereby the maximum moving area.

The unit is millimeters and the distances are measured from the machine reference point (machine coordinates).

## Zero point

The zero point refers to the reference point of the coordinates in the working file. It is the position with a specific X and Y-axis coordinate within the NC file, e.g. the left-hand bottom corner. All processing distances are measured from here.

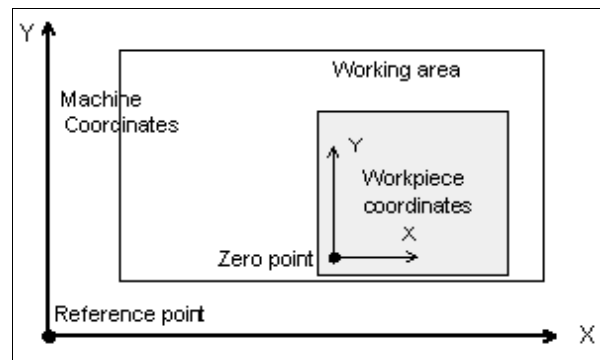

Working area and help positions

*Zero point as origin of the workpiece coordinates*

The zero point can also be defined manually. To do this, it is necessary to move to the required position using jog movement and then save this as the new zero point. The positions of the axes can also be saved individually.

The unit is millimeters and the lengths represent the absolute distance from the machine reference point (machine coordinates).

## Park position

*Defined position for breaks*

It is necessary to define a park position if the machine slide is to be moved out of the working area at certain times. This may be necessary for a tool change, for example, or for clamping the workpiece.

It is also possible to make this definition during jog movement by moving into position with the keyboard or mouse.

The parked position can be moved to in jog movement or automatically during a tool change and at the end of a working process.

The unit is millimeters and the distances are measured from the machine reference point (machine coordinates).

## Scaling factors

It is possible to compensate for calibration differences using the scaling factors. If both the axis resolution and the unit of measurement are set correctly but the machine does not move to the exact length nevertheless, this problem can be corrected using the scaling factors.

The values must be specified to 3 decimal places and are used for multiplying the coordinate values to which the machine is to move. It affects the imported NC data only.

## Tool lift

*Additional clearance for avoiding collisions*

It is possible to define an additional height above the zero point level of the Z-axis as a safety clearance. The tool is lifted above the zero point by this distance during every unproductive movement with rapid speed and the new height is used as tool lift height.

On the next plunge movement, **WinPC-NC** first covers the safety clearance down to the zero point at high speed, before pressing into the material with the defined plunge speed.

## Unit of measurement

*Wide range of predefined units of measurement*

The unit of measurement for working data must be defined using this parameter. All coordinate values in the working file are related to a particular dimension.

The possible units are millimeters and inches. HPGL files are usually in units of 1/40 mm or 1 mil, while drilling data are usually in 1/100 mm or also 1 mil.

## Units in the program


The *UNITS* parameter defines the units for dimensions and speeds used in the graphical display and the parameters.

**It is possible to select between three options :**

- Millimeters and millimeter/second (mm and mm/s)
- Millimeters and millimeter/minute (mm and mm/min)
- Inch and inches/minute (inch and inch/min)

## 4.4. Data format and associated parameters

**WinPC-NC** can read and process various data formats. The format of the NC file can be selected manually or registered using an automatic recognition function.

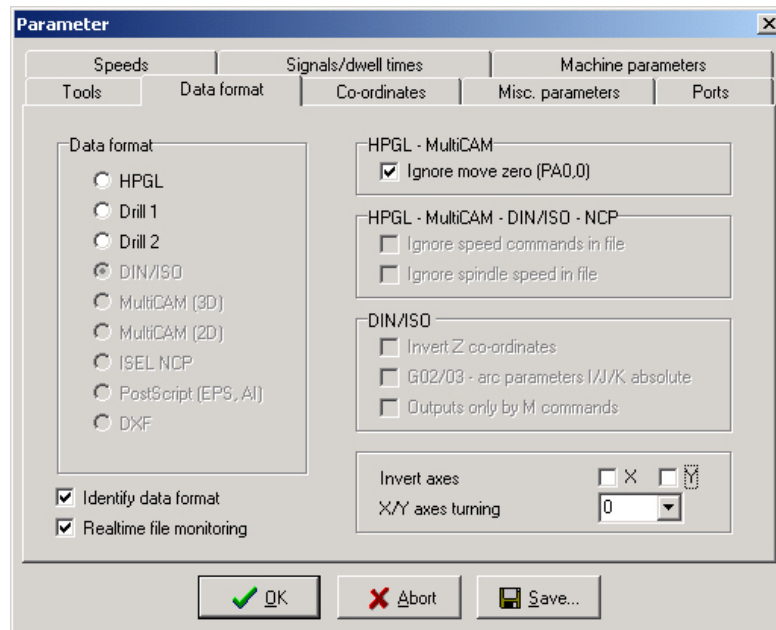

Data formats and associated parameters

## Data format

**WinPC-NC** understands various NC data formats, and is able to import these files, display them and perform the movements on the machine. At present, the commonly used plotter format HPGL, and two drilling formats are possible.

HPGL is from the well known plotters made by Hewlett Packard and is supported by almost every CAD or drawing program.

### *Plotting and drilling formats*

The drilling formats are based on the following standards: Sieb&Maier1000, Sieb&Maier3000 and Excellon. In other words, it should be possible to process working files in these formats without any problems.

The appendix contains a list and description of commands in the individual formats. In the event of problems during processing, for example if unknown commands or commands which cannot be interpreted are encountered, then the working file can be analysed using this description and revised with the editor.




---

**WinPC-NC usually recognizes the format of the selected file automatically.**

---

## Automatic identification of the format

Usually most of the supporting NC formats are automatically recognized by **WinPC-NC** during file opening. It rarely happens that

errors are produced in this way. If it should be the case they can be easily eliminated by switching off the identification function and by manual adjustment of the correct format.

## Ignore movement to zero (PA0,0)

It is a feature of HPGL files that there is usually a PA0,0 command at the end of the program to move to the coordinate zero point. This can be suppressed using this parameter if it is not required.

## Invert axes


The X and Y-axes and their coordinates can be mirrored independently of one another for all formats. A changed parameter is immediately visible in the graphical display.

## Turning of X/Y axes

The NC data can be rotated around the zero point, e. g. for a better placement on the material. Rotation always happens in 90 degree steps.

## Realtime file display


It is possible to obtain a general view of the current program position during a job by a file display. This display shows in realtime the actual executed command by a cursor bar during operation. The file display *realtime* applies to all formats, excepting postscript format and shows files of up to 32000 lines.

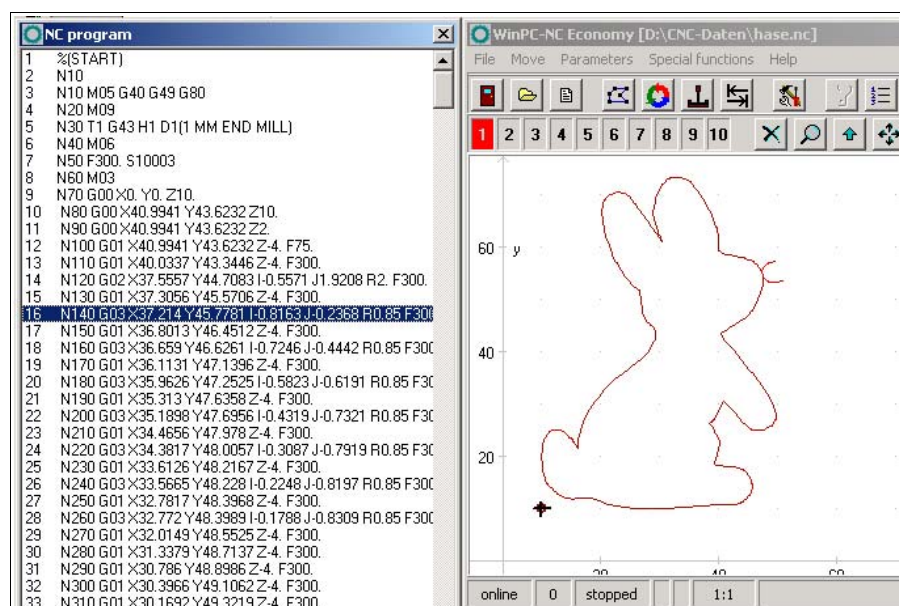

File display of realtime during a job

## 4.5. Miscellaneous parameters

The miscellaneous parameters include various switches and other settings which are not assigned to any other group.

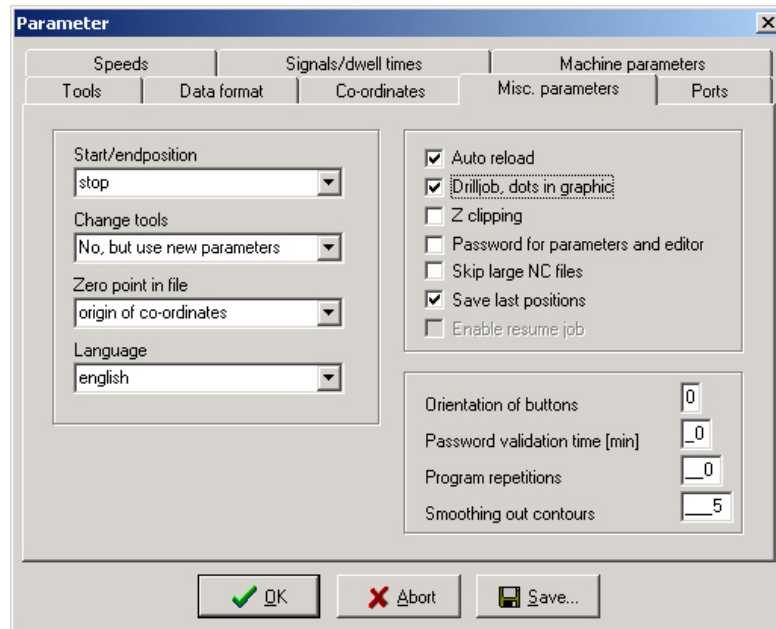

Miscellaneous parameters

### Start and end position

This switch specifies where the start and end point of each working process should be located. The machine also moves to the position after reference movement.

**There are 3 possible start and end positions :**

<b>Stop</b>	<i>WinPC-NC</i> stops at the reference position after reference movement, and at the last coordinate after each job process
<b>Zero point</b>	The machine moves to the defined zero point after reference movement and after each job process.
<b>Park position</b>	<i>WinPC-NC</i> moves to the defined parked position after reference movement and after each job process.

It is a good idea to move to a certain position after the working process if space is required in order to change the workpiece.

## Tool change

The parameter defines how **WinPC-NC** handles the tool change commands during a working process.

**There are 4 possibilities for the tool change :**

<b>NO</b>	No tool change is performed, the entire working process takes place with the current tool
<b>YES</b>	Performs the tool change and remains stopped in the current position for every tool change
<b>YES at park position</b>	Performs the tool change and moves to the defined park position for every tool change
<b>NO but use new values</b>	No tool change is performed, although the values for plunge depth, plunge speed and feed speed of the new tool are adopted.

## Zero point in file

The workpiece zero point is the point in the NC file which has its position defined in the coordinate parameters. However, it can be located at various points inside or outside the workpiece and these points are defined here.

**Three positions are possible :**

<b>Bottom left</b>	The zero point is at the smallest X and Y-axis coordinates in the file, normally at the bottom left edge. Mostly used with HPGL files.
<b>Origin of Coordinates</b>	The zero point is at the coordinate origin, i.e. where the CAD programs places it for the output. N This setting is to be recommended if several files are being used on the same workpiece, e.g. routing and drilling a board or when using G code files.
<b>Center</b>	The zero point is in the middle of the workpiece, i.e. exactly in the center of the coordinate dimensions in the X and Y-axis directions. This setting is useful for processing round workpieces, e.g. plates.

## Language

**WinPC-NC** is multilingual. The standard version already includes a few languages, and additional languages can easily be bolted on if required. The available languages are listed in a menu.



According to the status of June 2006 following languages are available: german, english, french, spanish, portuguese, italian, turkish and polish.



**The language changeover takes place as soon as you select a new language and click *Save*.**

## Automatic reload


The *reload* function continuously monitors the date and time of the currently loaded file and reloads the newly modified file if there is a discrepancy.

Using this function, for example, it is possible to edit an NC file in the drawing program, make continuous changes to it and then, when you switch back to **WinPC-NC**, to be able to check all the changes on the screen straight away.

## Drill job, dots in graphic

*Marking  
insertion  
points*

The graphical display does not show holes drilled with HPGL, MultiCAM or G code formats. Activating this parameter marks all insertion points with a small circle.

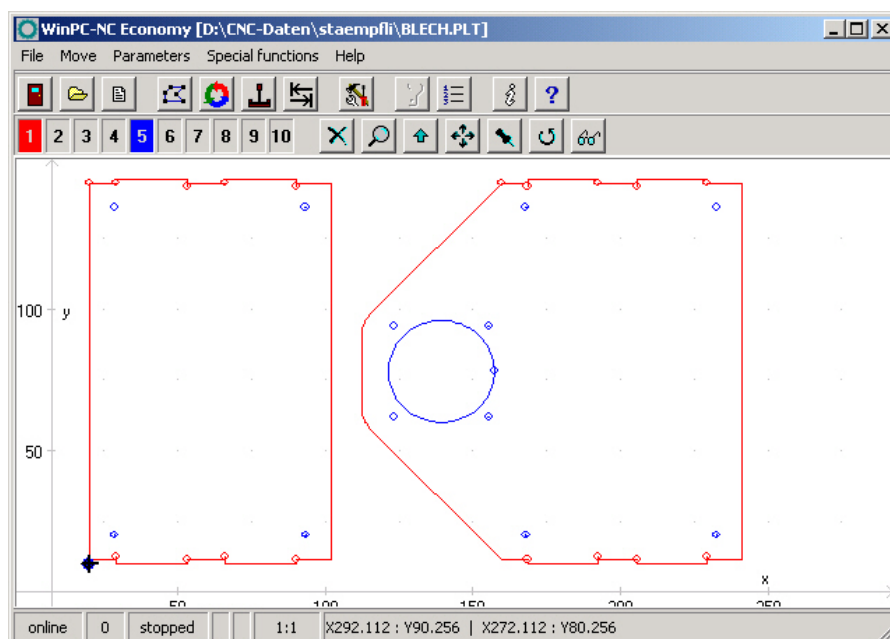

Display as drilling job with marks showing insertion points

## Z-axis clipping

When the Z-axis clipping function is activated, **WinPC-NC** monitors the maximum Z-axis depth and cuts off all deeper movements at the working area limit.

## Password and period of validity

This parameter activates a password which must be entered prior to change the parameters or a loaded program. The password is fixed.


The period of validity stipulates the term how long the password is valid and how long it is not interrogated again.

## Skip large NC files

### *Faster display*

The analysis function and graphical display may take an extremely long time with very large NC files. This process can be speeded up by only reading in and displaying the first parts of the file. In such a case, a large cross is superimposed on the graphic display to indicate that not all of the file is visible.

The following functions are not available in this partial view: Zoom, shift and set position.

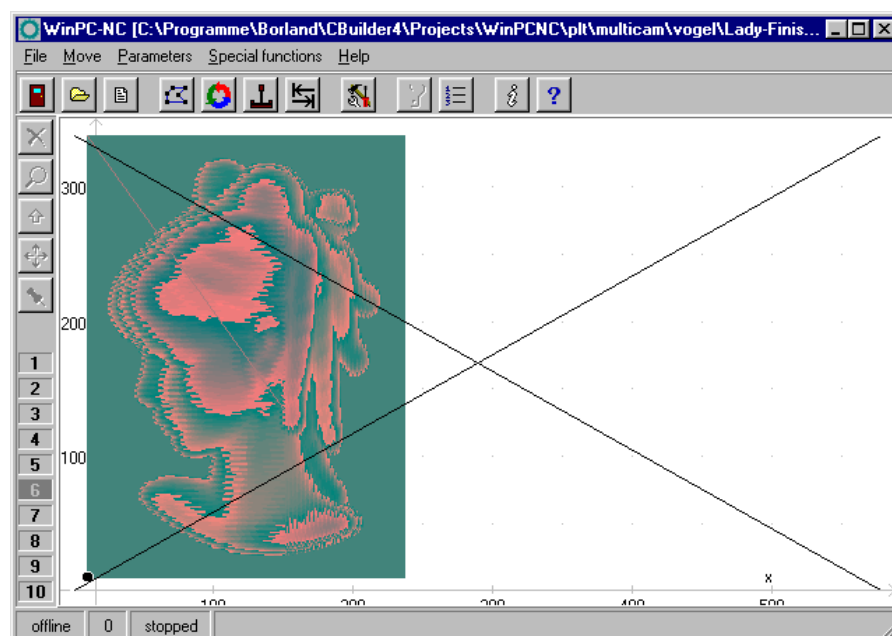

Partial display of a file with marking

## Save last positions


**WinPC-NC** can save the current machine position after each movement and job. This is meaningful if the machine works without reference switches or if it is not always possible to carry out a reference movement.

The position values remain unchanged even after exiting or restarting the program.


## Button orientation

*Adapting the movement direction of the buttons*

It is possible to use 4 settings to rotate the X and Y-axis directions through 90 degrees at a time in order to adapt the orientation of the movement buttons in *jog mode* to take account of the machine orientation.

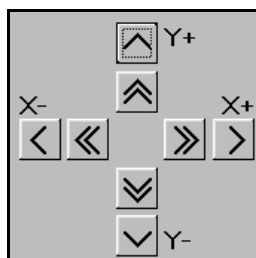

Button orientation position 0

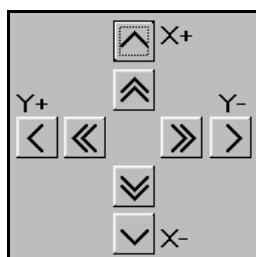

Button orientation position 1

Positions 2 and 3 turn the X and Y buttons through further 90 degree steps.

## Program repetitions

The program repetitions parameter enables you to repeat a working process up to 999 times. This enables series production to be achieved in conjunction with a start signal.


## Smoothing contours

*Filter for producing finer contours*

**WinPC-NC** is equipped with a filter in order to smooth contours and sheets consisting of many small vectors. This is necessary for producing fine and neat edges.

The parameter defines a factor of 0-2000.

## 4.6. Ports

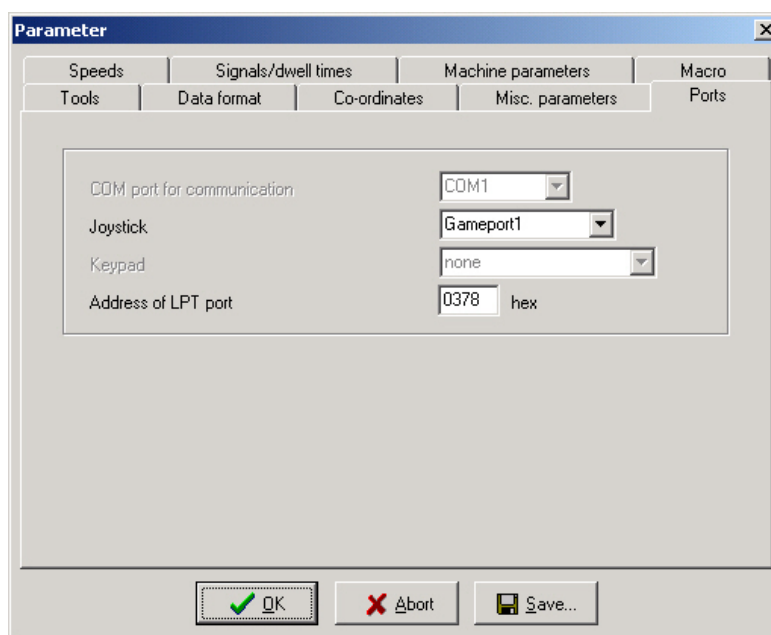

Port parameters

## Joystick

If you want to use a joystick to set up the machine, you must use this parameter to define the game port used.



---

**A connected joystick must be configured in the Windows system prior to use and must be calibrated with a special function.**

---


## Address of LPT port

### Address of the LPT port

**WinPC-NC Economy** actuates a connected machine directly by the existing printer port without requirement for additional hardware. However, it is not possible to identify the address of the port automatically. This information can be learned from the device manager in the windows operating system.

#### Please execute the following steps:

- open the *device manager* under *My Computer, control panel, system, hardware*
- open the category *Ports COM & LPT* and select the LPT port which is connected to the machine
- select with the right mouse button the function *properties* and then *resources*
- note the port address under which the LPT port is integrated into the system. For internal ports the port address usually is 0378hex.

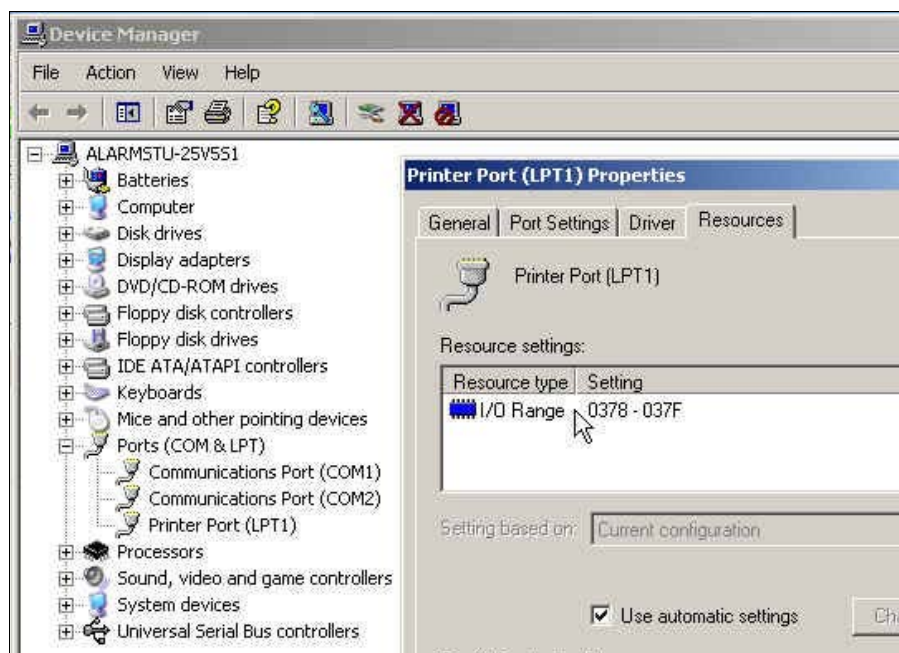

Identification of the LPT port address by the device manager

The detected port address has to be registered in **Win PC-NC** under *parameter-ports-address of LPT-port*. The procedure is finished by clicking *Save* and *OK*.




---


**When the program is delivered the LPT port address is registered with 0378hex by default.**

---

Further signals and inputs can be activated by **WinPC-NC Economy** with a second LPT port. Detailed information is given below.

## 4.7. Signals and dwell times

All input signals and associated parameters are grouped in a separate dialog box.

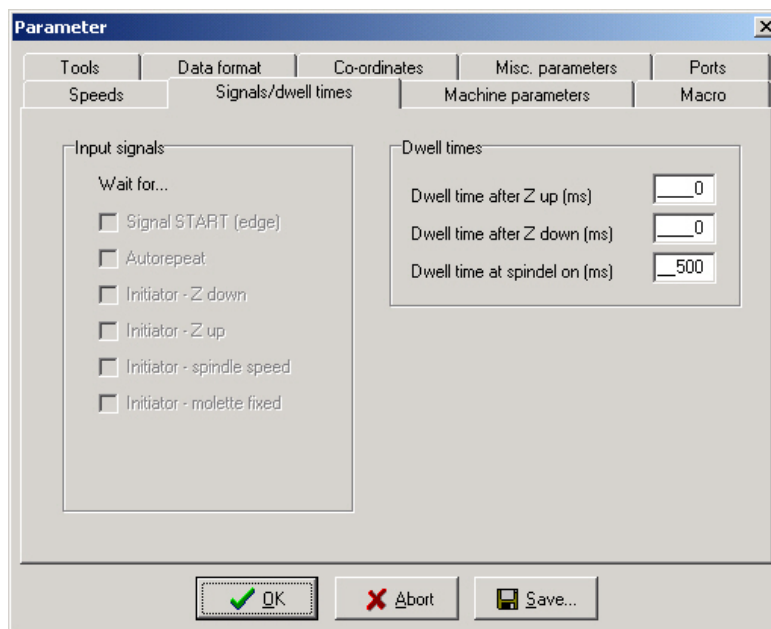

Signal parameters

### Input signals

Synchronisation with input signals ist available in **WinPC-NC Economy** and **Professional** only.

### Dwell time after Z up and Z down

In many applications, it is a good idea or indeed a requirement to wait a moment after the tool has been lowered or raised, before starting X and Y-axis movements. This may be the case when working with flexible materials or if you want the tool to freewheel.

The waiting time is defined in milliseconds.

### Spindle acceleration time

*Acceleration time for drilling spindle*

The start delay defines a waiting time in milliseconds which always counts down when the additional *Drilling spindle* output signal is activated.

This ensures that the drilling spindle has enough time to accelerate before it is used for the first time.

## 4.8. Maschine parameters

Machine-specific parameters include all settings which relate to the mechanical characteristics of the machine. Only some or even none of these parameters are present in certain OEM versions of **WinPC-NC**. Instead, the parameters will have already been set correctly in advance for the machine in question.



**Always take the greatest possible care when setting or modifying any machine-specific parameters, in order to avoid machine defects.**

For a better view the machine parameters are grouped in further windows which can be displayed by clicking the corresponding buttons.

	X	Y	Z	
Machine specific parameters				
Axes resolution	400	400	1600	Steps/Rev.
Distance per revolution	2.000	2.000	2.000	mm/U
Maximum speed	25.00	25.00	25.00	mm/s
Maximum start/stop speed	3.00	3.00	2.00	mm/s
Shortest ramp	400	500	700	ms
Invert movement direction	Yes	No	Yes	
Reference switch at	neg.	neg.	neg.	End
Reference sequence	z-x-y			Signals
Maximum spindle speed	20000			Measure
Clock length	11 us			

Machine-specific parameters

### Axis resolution

The resolution boxes define the number of motorsteps per rotation. If you are using gear units or step down/step up ratios, you can enter the calculated values here directly.

The unit is steps.

### Distance per rotation

You have to use this parameter to define what distance is moved during one motor rotation. Defining the axis resolution with two

parameters offers the advantage that no calculation inaccuracies can arise.

The unit is millimeters with decimal places.

## Maximum speed


You should use the *MOTOR TEST* function to ascertain the maximum speed of each axis. This represents the absolute top limit speed with which the axis can be moved.

*WinPC-NC* monitors the speed entries made in all other parameter windows and always corrects them to the value defined here.

The unit is millimeters with decimal places.

## Maximum start/stop speed

The start/stop speed specifies the fastest possible speed with which the stepper motors can start up without ramps. The value is important for calculating path control, because braking at sharp edges or corners does not have to be to a standstill, but only down to this start/stop speed.

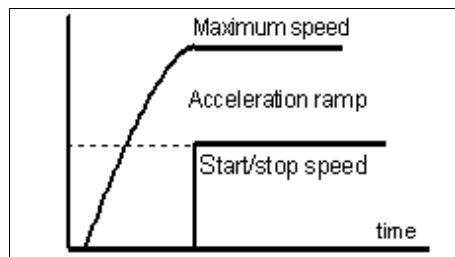

Start/stop speed and ramps

The optimum value can be ascertained with tests, e. g. by the function *MOTOR TEST*. Therefore it is necessary to switch off the ramp and accelerate the speed until step losses are caused. The value, detected in this way, should be reduced by 30% as a precaution.


## Shortest ramp

The *ramp* parameter specifies the length of the acceleration ramp until maximum speed is reached, or the deceleration ramp from maximum speed to stationary, in milliseconds.

*Individually  
adjustable ramp  
length*

During each movement, the speed is increased until the maximum speed is reached. At the end of each motor movement, the speed is slowly reduced until the motor ramp length comes to a stop.



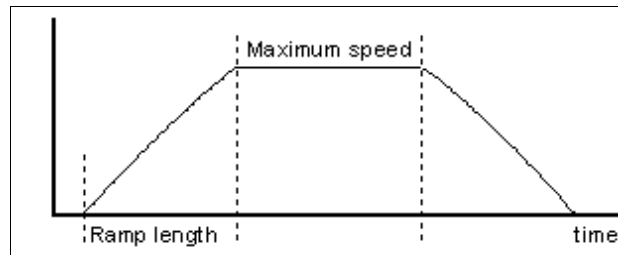

Speed profile of a motor movement

Accelerating and braking with ramps prevents step losses of the motors and allows faster maximum speeds. The gradient of the ramp remains unchanged in all movements, i.e. the ramp time is shorter for movements at slower speed.

## Invert movement direction

There are two possible remedies if one of the motors is moving in the wrong direction.

*Changing over  
the movement  
direction*

Either swap over the motor winding connections or change the movement direction with this parameter. The direction signal for controlling the motor is then inverted before being output.

## Reference switch

This parameter enables you to define in which direction the axis is moved in order to search for the switch. Movement clear from the switch then takes place in the opposite direction.

## Reference sequence

Reference movement of the individual axes takes place in a particular sequence. Usually, it is necessary to move the Z-axis upwards first so it is withdrawn from the workpiece. Then the two other axes move to their reference points.

*Possible faults at  
homing*

After the machine is started up for the first time, there may be faults with reference movement which can be remedied as follows:

- Axis moves in the wrong direction  
**Remedy :** Define that the reference switch is at the other end of the axis.
- Axis moves in the correct direction, but stops after reaching the switch and does not move clear again  
**Remedy :** Define the reference switch at the other end and change the switch logic.

## Clocking pulse length

### Signal-timing

Controlling stepper motor drives is usually executed by brief clocking impulses. The pulse duration is susceptible by this parameter and they are always generated for at least 10µsec.

These impulses may be too short to be recognized by the electronics when using specific input filters or opto-couplers. Therefore you have the possibility to prolong this time by parameter. However, it has to be considered that longer pulse duration may affect calculation performance and therefore should be avoided.



**If you really have to set the clocking pulse duration, please select the smallest possible value in order to guarantee a steady and constant run of your axes.**

Using the SMC version and SMC stepper motor cards the clock pulse duration is without any impact.

## Parameters to machine sizes

	X	Y	Z	
Machine size from	+ 0.00	+ 0.00	+ 0.00	mm
to	+ 600.00	+ 300.00	+ 120.00	mm
Reference point is...	+ 0.00	+ 0.00	+ 0.00	mm
Homing offset	+ 1.00	+ 1.00	+ 1.00	mm
Backlash	0	0	0	Steps

☐ Machine area monitoring  
☐ Molette closed by default  
☐ Check ref. switches at reference start

Signals  
 Axes XYZ

OK Abort Save...

Second dialog box with machine-specific parameters

## Machine bed dimensions and area monitoring

*Machine size*      The effective movement area of the machine can be defined using these parameters. If area monitoring is activated, **WinPC-NC** checks and monitors these limits during subsequent movements, including jog movement.

A parameter activates or deactivates monitoring of this limits.

## Reference offset

*Safe moving free of the reference switch*      To avoid a stop directly at the reference switch's edge after a reference and moving free it is possible to determine an additional path with the reference offset. This has to be carried out after moving free from the switch. First after moving the offset the axis is resetted or the defined reference position is adjusted.

Typical values are 0.5 to 1mm additional distances to the switch.

## Checking reference switches

*Reference move exclusive with vacant switches*      Prior to a reference move the parameter induces **WinPC-NC** to check the switches. Only if each defined switch is vacant a reference move can take place.

This test makes sense if several reference switches are connected on the LPT port by a single input line and if it is not possible for **WinPC-NC** to recognize the axis currently placed on its switch.

In case if the reference move should be rejected due to one or several actuated switches, it is necessary to move the switches free by the function *JOG*.

## Signal wizzard

*Userfriendly adjustment of the signals*      By means of the *signal wizzard* a userfriendly adjustment and definition of all inputs and outputs is ensured. As this task is of great importance, you will receive detailed information concerning possibilities in a separat chapter.

---

## 5. Initial start-up with the machine

---

### *Machine adjustment*

After software installation on your PC it is necessary to carry out some start-up processes and corresponding adjustments.

This procedure is only necessary with the initial start-up procedure and generally relates to the adjustment of your machine. In case if you have acquired **WinPC-NC Light** together with the machine either most of the parameters are correctly preadjusted or you have received an additional disk with the corresponding adjustments. If this is the case the following described procedure can be disregarded.

### 5.1. Connecting the machine

Connecting the machine is made on one or two LPT printer ports of the PC and the corresponding cables or adapters have to be used or manufactured.



---

#### **Attention !**

**Greatest care has to be taken when connecting all cables to the housing. Following actions can cause serious damage:  
Incorrect assignment of the signal cable, plug incorrectly inserted, cables incorrectly connected.**

---

Starting the entire unit is not allowed until all necessary and state specific safety rules have been accomplished and checked. The user is responsible for unit operation.



---

#### **Attention !**

**For further interrogation of the status *emergency stop* or *ready for operation* it is essential to use one of the inputs. In this way it is possible for the control to stop actuation of output signals if necessary. Detailed information is provided in the documentation concerning controlling software. Please observe all instructions concerning machine safety.**

---

Assignment and application of the possible input/output signals concerning the existing port pins is characterized in the following chapter. For an initial start-up, you do not require any signal input or, to simplify matters, you can use the predefined signals.





---

**Please note !**

**The software *WinPC-NC Light* is a controlling component only and used within a unit. In order to obtain a real working machine the software has to be completed by PC equipment, working appliance, drive systems and mechanics. The user is responsible for operation safety.**

---

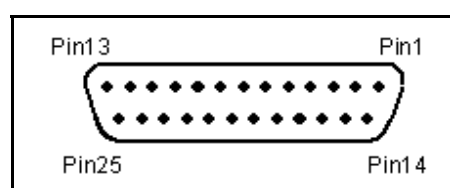

LPT port as 25 pole SUB-D-female connector

### 5.1.1. Pin assignment of clock/direction version:

*Pinning LPT 1  
(clock/direction)*

**All signals on the LPT printer ports present 5V TTL level.  
Pinning of the first LPT port is as follows:**

<b>Pin 2</b>	<b>output</b>	direction motor X
<b>Pin 3</b>	<b>output</b>	clock motor X
<b>Pin 4</b>	<b>output</b>	direction motor Y
<b>Pin 5</b>	<b>output</b>	clock motor Y
<b>Pin 6</b>	<b>output</b>	direction motor Z
<b>Pin 7</b>	<b>output</b>	clock motor Z
<b>Pin 8</b>	<b>output</b>	direction motor 4 (i.g.tangential axis)
<b>Pin 9</b>	<b>output</b>	clock motor 4 (i.g. tangential axis)
<b>Pin 1</b>	<b>output</b>	drilling spindle on/off (default)
<b>Pin 14</b>	<b>output</b>	coolant pump on/off (default)
<b>Pin 16</b>	<b>output</b>	current reduction (default)
<b>Pin 17</b>	<b>output</b>	job works (default)
<b>Pin 10</b>	<b>input</b>	reference switch X (default)
<b>Pin 11</b>	<b>input</b>	reference switch Y (default)
<b>Pin 12</b>	<b>input</b>	reference switch Z (default)
<b>Pin 13</b>	<b>input</b>	sensor/surface block (default)
<b>Pin 15</b>	<b>input</b>	vacant
<b>Pin 18-25</b>		signal mass (0V GND)

*User definable additional in-/outputs* All inputs on pins 10, 11, 12, 13 and 15 as well as the additional outputs at pins 1, 14, 16 and 17 are free definable and assignable to the desired signals. When the software is delivered above mentioned signals are assigned.

### 5.1.2. Pinning of the SMC version:

SMC stepper motor cards are connected to the PC by a commonly used printing cable. SMC cards have all three reference switches connected to pin 11 and there are no additional standardized inputs and outputs available.

*Pinning LPT1 (SMC)*

**Pin assignment of the first LPT port as follows :**

<b>Pin 2</b>	<b>Data1</b>	1+2 code of the current intensity phase A
<b>Pin 3</b>	<b>Data2</b>	11-no current 01-20% 10-60% 00-100%
<b>Pin 4</b>	<b>Data3</b>	direction of current phase A
<b>Pin 5</b>	<b>Data4</b>	4+5 code of the current intensity phase B
<b>Pin 6</b>	<b>Data5</b>	11-no current 01-20% 10-60% 00-100%
<b>Pin 7</b>	<b>Data6</b>	direction of current phase B
<b>Pin 8</b>	<b>Data7</b>	7+8 code for motor X/Y/Z
<b>Pin 9</b>	<b>Data8</b>	00-X 10-Y 01-Z
<b>Pin 1</b>	<b>Strobe</b>	adopting the signals
<b>Pin 14</b>	<b>output</b>	coolant pump on/off (default)
<b>Pin 16</b>	<b>output</b>	drilling spindle on/off (default)
<b>Pin 17</b>	<b>output</b>	vacant
<b>Pin 10</b>	<b>input</b>	vacant
<b>Pin 11</b>	<b>input</b>	reference switch
<b>Pin 12</b>	<b>input</b>	vacant
<b>Pin 13</b>	<b>input</b>	vacant
<b>Pin 15</b>	<b>input</b>	vacant
<b>Pin 18-25</b>		signal mass (0V GND)

Further technical information concerning controlling SMC cards can be learned from documentation of the card. If the additional signals or vacant inputs of LPT1 are to be used by the machine, they have to be tapped directly on the cable.




---

### Attention !

For safety reasons it is essential to use limit switches on all axes. In order to avoid accidents by contact during operation it is advisable to install a system for access control, e. g. a protective housing or a safety fence. Please connect these safety appliances with the controlling component and define the corresponding inputs.

---

## 5.2. Determination of axis resolution

For calculating the required distances and speeds it is necessary to tell **WinPC-NC** precisely the definition of the axis resolution.

*Two parameters  
for avoiding  
calculation  
inaccuracies*

Please open the parameter dialog box *parameter - machine* and determine the exact data of your mechanics and drives for each axis by the first two parameters.

The parameter *axis resolution* defines the number of steps or increments per rotation for the corresponding motor. Please consider the electronic settings relating to the macro/micro stepping operation and a possibly integrated reduction ratio.

*Motorsteps and  
distance per  
rotation*

The required value is the number of motorsteps **WinPC-NC** has to create in order to carry out exactly one rotation round the spindle or the shaft.

The second parameter *distance per rotation* defines the distance which is made exactly by the number of above mentioned motorsteps. With spindles it is the spindle rise or with belts or gear racks it is the graduated circle size of the pinion.




---

**Incorrectly setted axis resolutions cause dimensional inaccuracies and inexact speeds.**

---


## 5.3. Definition of LPT port

By the next step you have to define in **WinPC-NC Light** the used LPT port respectively to determine its internal port address.

*Ascertainment of  
LPT port adress*

In order to ascertain the port address you have to activate the device manager in the system control. Please carry out the following actions:

1. Open the *device manager* under *My computer, control panel, system, hardware*
2. Open the category *Ports COM & LPT* and select the LPT port to which the machine is connected.
3. Click with the right mouse button to *properties* followed by *resources*
4. Note the port address under which the LPT port is integrated into the system. With onboard ports it is normally port address 0378hex

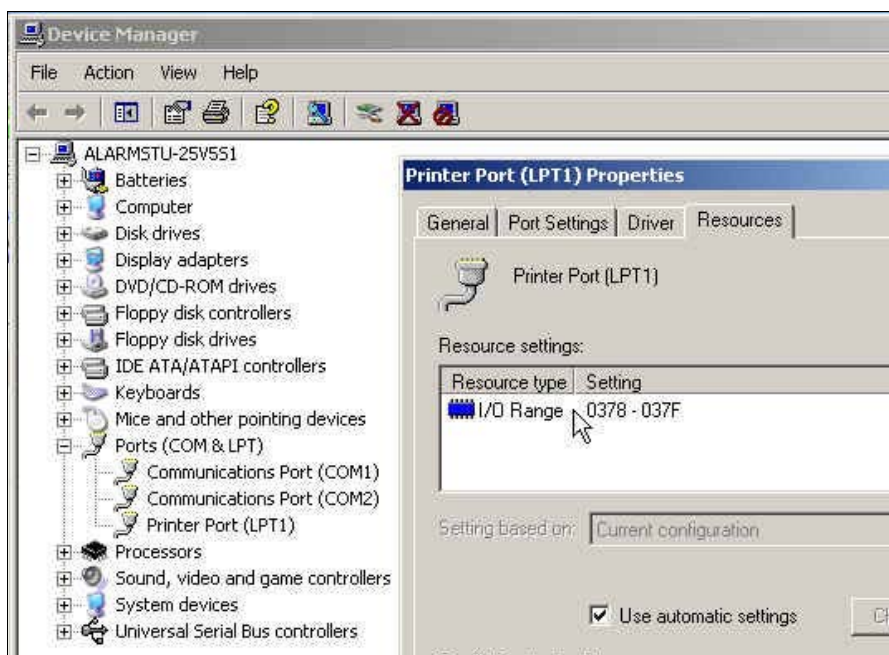

Identification of the LPT port address by the device manager

The detected port address has to be registered in **WinPC-NC** under *paramater machine-signals-port addresses* followed by clicking *Save* and *OK*.

After this process a simple test run with the function *JOG MOVE* or *MOTOR TEST* should be possible. Please act with the greatest possible care and be always aware of uncontrolled machine movements. If the axes do not move smooth or move at all, just increase the clock length parameter step by step.





**When delivered the LPT port address is registered under 0378hex. This registration applies to most internal ports.**


 
## 5.4. Determination of direction

Call the function *JOG MOVE* and move all axes with the cursor button or by mouse clicking to the arrow buttons and check machine direction.

Each button corresponds to a certain axis or direction. Please start with axis X.

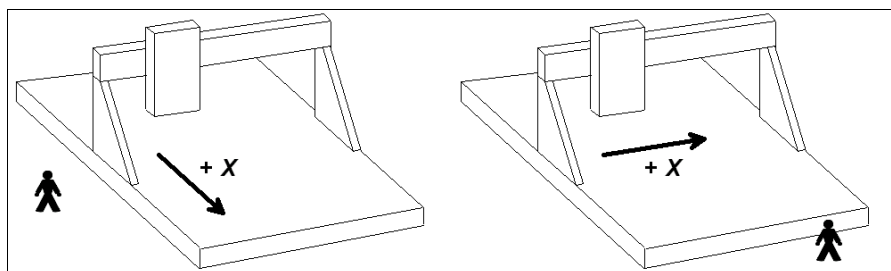



Arrow keys showing to the right side are to start a positive movement of the X-axis, i.e. following movement to the right of the machine.

Arrow keys showing to the left side are to move the machine left in opposite direction.


If this is not the case, one of the following errors may have occurred...

Error	Possible cause	Solution
Machine does not move	Incorrect port Incorrect port pinning Maschine off	Port adjustment Control of pinnings Check whether motors are energized and provide supply
Movement of the wrong axis	Incorrect port pinning	Control and adjust the port pinnings
Axis X moves always in opposite direction, i.e. moves to the left by activated right-hand arrow and the other way round	Direction signal works with incorrect logic	Change the parameter <i>INVERT MOVE DIRECTION</i> under machine parameters

 After checking the X-axis a further test of the both other axes is advisable. If necessary, please correct move direction by parameter.

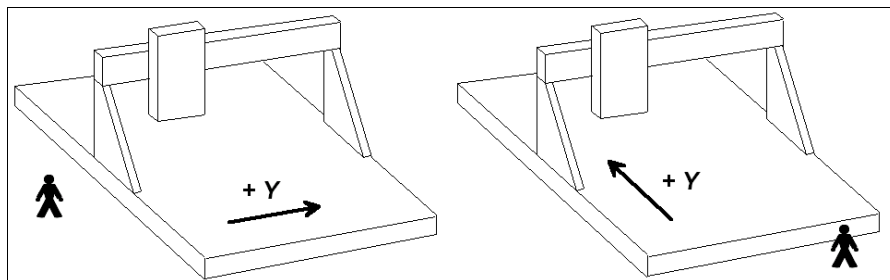


 The machine has to move backwards when arrow keys showing to the top.



The Z-axis moves down when arrow keys showing downwards.


For a direction reversal of one axis it is only necessary to change the parameter *INVERT MOVE DIRECTION*.

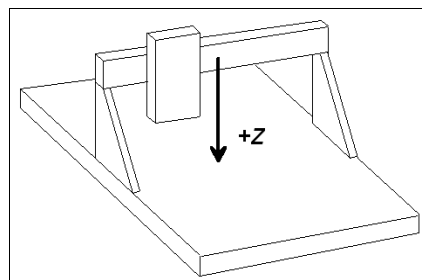

**The move directions to be determined are always relating to the movement of the tool above the workpiece. Please pay attention to the correct setting of move directions by mechanics with moved table. The moved table runs always opposite to the arrow keys in order to guarantee a correct move direction of the tool above the workpiece.**

## 5.5. Adjustment of the reference switches

The way of function of the limit and reference switches can easily be checked with the special function *SIGNAL TEST*. After activating this function a window appears with LED display for the most important inputs.

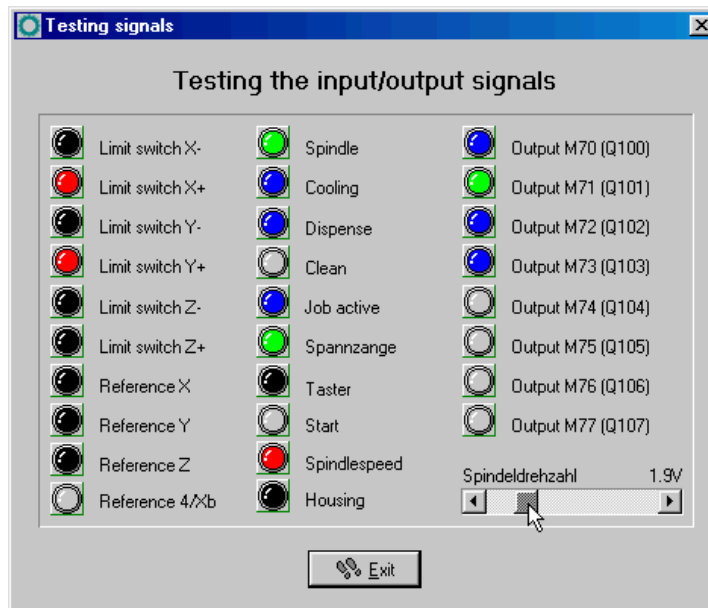

Special function *SIGNAL TEST* with LED displays of the most important inputs

*Manual activating of the switch*

After manual activating the switch of your machine please observe the reactions on the screen. Each change of switch must be clearly displayed. The LED flashes of the reference switch should change the color from black to red.

The definition of the reference switches has been correctly determined when the LED is black in unpressed condition and changes to red in pressed condition.

Depending on the used switch (NO contact – NC contact) the switching logic may be misapplied, i.e. red colored with the unpressed switch and black colored with the pressed switch. If this is the case, a change of the switching logic of the reference switch by parameter is required.

*Determination of switching logic*

**Please carry out the following steps :**

1. Open parameter dialog box *parameter-machine-signals*
2. Select the corresponding reference switch in left-hand window
3. Select the inverted entry in the drop-down menu below and accept the setting, e.g. change from **LPT1 PIN 10** to **LPT1 PIN10 INV**
4. Save the latest setting and recheck by function *SIGNAL TEST*

A detailed description of the signal wizard and the possibilities for defining and setting the inputs and outputs is listed in the next chapter.

## 5.6. Sequence and direction of reference move

In the following step settings for reference move of the machine are stipulated. Please carry out the following steps:

1. Open parameter dialog box *parameter-machine*
2. Under *reference switch at pos./neg. end* you have to adjust on which axis side the switch is located. If it is not possible to be directly ascertained, change again to the function *JOG MOVE* and check by moving and observing the position counters and note to which position the axes move to in the moment when they are approaching the switch.
3. After the setting of all switches there is nothing else to do than selecting the *reference sequence*. The desired sequence can be stipulated in the drop-down menu. Normally it is always the Z-axis which starts moving upon to it's switch followed by the other axes.
4. If you intend a reference move of one or several axes into positive direction, it makes sense to place the machine zero point not at the switch but define another position by parameter.

## 5.7. Control of settings

After respecting all items a reference move with your machine should not cause any problems. Subsequent to the execution and saving of all parameter settings please press the function key (F8) or select the corresponding function by menu.

### *Reference move for control*

During the reference move all axes run upwards to their switch according to the adjusted sequence and then downwards the switch with reduced speed. Exactly at the switching edge all axes are stopping and marking the reference point.

If this procedure should cause problems or stop with indicating error messages some of the settings have been incorrectly carried out. The tabulation below provides additional information concerning different kinds of errors and corresponding solutions.

Error	Solution
Axis moves into wrong direction	Define the reference switch at the other end

Error	Solution
Axis moves into correct direction, but very slowly	Switching logic has been adjusted incorrectly and has to be inverted <b>and</b> define the reference switch at the other end
Axis moves slowly into correct direction, but stops on the switch	Switching logic has been adjusted incorrectly and has to be inverted <b>and</b> define the reference switch at the other end
Axis moves very slowly into wrong direction	Switching logic has been adjusted incorrectly and has to be inverted

## 5.8. Additional steps

The most important tasks have been finished by connecting the machine and setting the parameters. Additional actions are recommended in the following sequence :

1. Determination of the optimal ramps and speeds of all axes by the special function *MOTOR TEST*.
2. Determination of further speeds for *JOG MOVE* and *REFERENCE MOVE* by these values.
3. Connecting additional desired and required input and output signals definable by the signal wizard.

## 6. Signal wizzard

### 6.1. Using input and output signals

One of the most essential functions of **WinPC-NC** is the management of input and output signals.


*Input and output signals*

By means of inputs many useful functions have been implemented, e.g.

- Monitoring of the axes by limit switches
- Moving reference and thereby calibration of the axes
- Synchronization with various signals, e.g. *Start*
- Monitoring of the protection hood and safety fences

By means of output signals **WinPC-NC** is able to control various additional appliances or reconcile the process with other components. Examples for outputs are...

- Switching spindle and cooling
- Locking the protection hood during a job
- Switching the dispensing pump

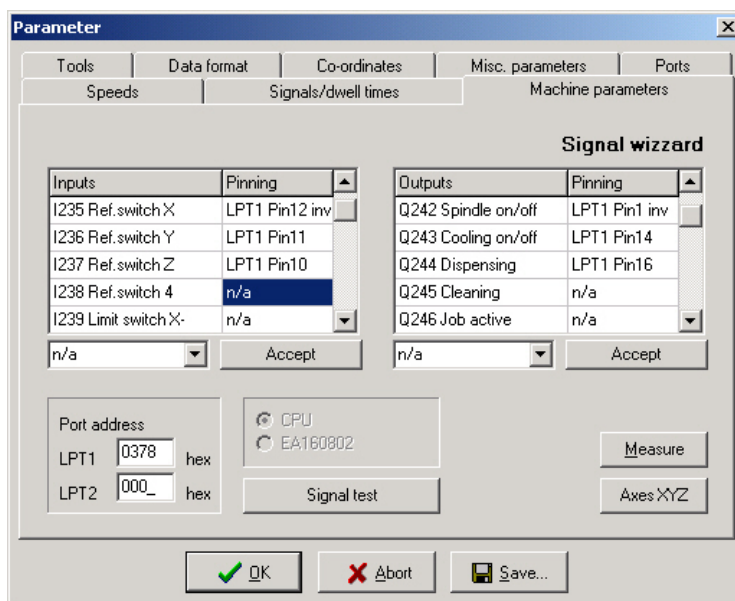

Signal wizzard

*Integration of the signals*

**WinPC-NC** is able to manage a lot of different signals, certainly all inputs and outputs are not required for each task. In this way it is quite simple to assign the required signals to the available supplies of the LPT printer port using the signal wizzard.

Each LPT printer port disposes of 5 input lines at the pins 10, 11, 12, 13 and 15 and 4 additional output lines at the pins 1, 14, 16 and 17.

You can connect the required signals at any possible pin. The assignment is subsequently effected by the signal wizzard which is activated by *parameter-machine-signals*.




**Attention: Please take greatest care when assigning and testing the inputs and outputs. Be always aware of uncontrolled actions of the output signals.**

---

*Port address of the interface*

Prior to assignment of the individual signals the LPT port address has to be checked and defined. Using a second port it is essential to enter also this address. These addresses are determined by the operating system and are indicated by the device manager, as described in the preceding chapter.

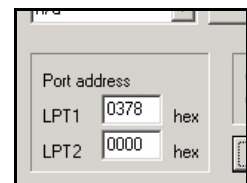


## 6.2. Assignment of inputs

*Assignment of inputs*


**Please execute the following steps for assigning the input lines:**

1. Connect the required switch or sensor to the available pin
2. First click to *Signal test* and observe the LEDs in the next window which are symbolizing the status of the individual input lines
3. Note or notice the pin number and the switching logic after manual pressing the individual switches. A normally open (NO) contact is characterized when the LED light changes from black to red during pressing. However, a normally closed (NC) contact is characterized when the LED light changes from red to black.

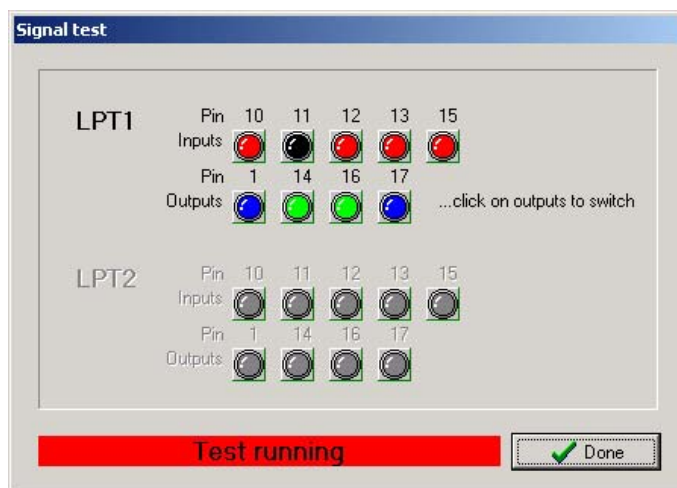

Interactive signal testing

4. Click to the function *Done* and change again into the window of the signal wizzard. Select now the corresponding input signal in the lefthand window (e.g. I235 reference switch X) and open the drop-down menu below in order to assign the pin number (e.g. LPT1 Pin11).

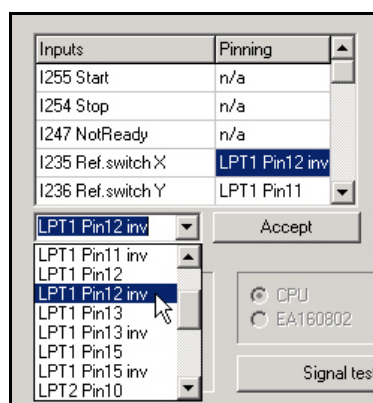

Assignment of pin numbers to the input lines

5. With normally open contacts (color change from black to red) always select the normal pin number. With normally closed contacts (color change from red to black) select the inverted pin number, e.g. LPT1 PIN11 Inv.
6. After clicking the button *Accept* the selected pin number is displayed in the assignment table.
7. Proceed in the same way with all other required input signals.
8. Save the parameter settings and if necessary, check once more all assignments with the function *special functions-signal test*. Herewith a pressed switch must always produce a red LED light, i.e. a HIGH level.






With inputs *WinPC-NC* reacts only to a **HIGH** level. Please take care that the switching logic with the possibility for inverting is assigned in the way that an activated switch generates a **HIGH** level.

### 6.3. Assignment of output lines

#### *Assignment of outputs*


The assignment of outputs is similar to the assignment of inputs. Please carry out the following steps :

1. Connect the required cables to the available pins and use for control purposes a LED light or a lamp.
2. Click to *Signal test* and observe the LEDs in the next window which are symbolizing the status of the individual output lines

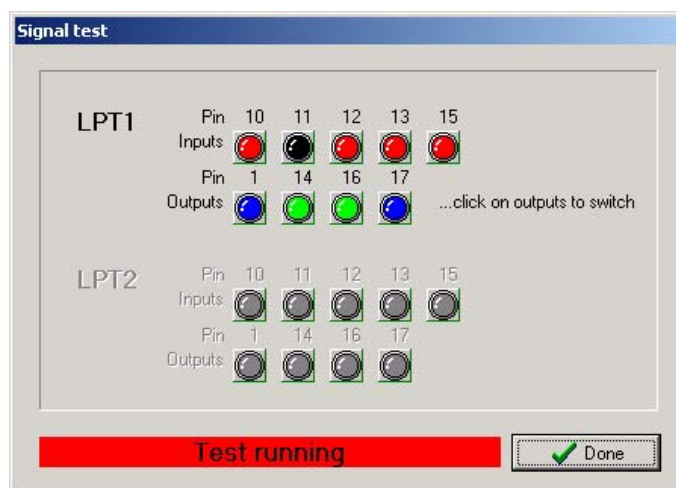

Interactive signal testing

3. Click by mouse on to the possible outputs and observe the level of the cables. A blue LED light signalizes a LOW level or an output switched off. A green LED light signalizes a HIGH level or an output switched on. Please note or notice the corresponding pins as well as the switching logic.
4. Click to the button *Done* and change again into the window of the signal wizzard. Select now the corresponding output signal in the right-hand window (e.g. Q242 spindle on/off) and open the drop-down menu below in order to assign the pin number (e.g. LPT1 PIN1).
5. After clicking the button *Accept* the selected pin number is displayed in the assignment table.

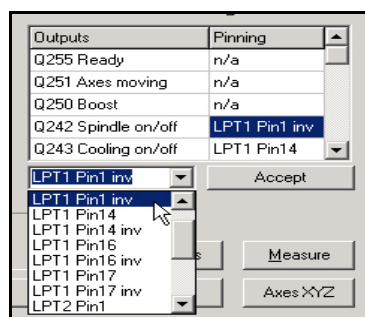

Assignment of the pin number for output lines

6. Proceed in the same way with all other required input signals and finally save the settings.

## 6.4. Input signals available

*Possible inputs*

**WinPC-NC is able to manage following input signals:**

Input signal	Assigned action
I255 Start	Starts loaded job
I254 Stop	Stops immediately each running action with HIGH level, subsequently another reference move has to be carried out
I247 Not ready	Monitors whether the machine is ready and the drives. With HIGH level each running action is immediately stopped.
I235-238 Reference switch	Reference switch of all 4 axes
I239-242 Limit switch -	Limit switch positioned at the negative end of the axis
I243-246 Limit switch +	Limit switch positioned at the positive end of the axis
I229-232 Limit switch Summary	Limit switch inputs, if only one switch is appropriate for both ends of the axes, e.g. a flexible switch moving on two cams. Using these inputs, <b>WinPC-NC</b> is not able to recognize the move direction and obviate continuation of the move.
I222 Protection hood	Safety function for protection hoods, light screens and access controls
I160-169 vacant	Signals freely to dispose, with macro programming.

All additional input signals which are indicated in the table are reserved to special functions or only available in **WinPC-NC Professional**.

## 6.5. Output signals available

*Possible outputs*      **WinPC-NC is able to manage the following output signals :**

Output signal	Assigned actions
Q255 Ready	Indicates whether the controlling software is ready with HIGH level. In the case of error the output turns to LOW.
Q251 Axes move	Indicates moving (HIGH) or stopping (LOW) axes. This signal can be used for reducing current at the rating class limits.
Q250 Boost	Indicates ramp moving during the run of axes (HIGH) or displays stopped axes respectively constantly moving axes (LOW). This signal can be used for reducing current at the rating class limits.
Q242 Spindle	Switches on/off the drilling-/milling spindle.
Q243 Cooling	Switches on/off the coolant pump or the spray cooling
Q244 Dispensing	Switches on/off the dispensing signal.
Q245 Purging with compressed air	Indicates with HIGH level an upwards moving and thus a withdrawing Z-axis.
Q246 Job works	Job working in HIGH level and thus indicates automatic operation.
Q220-230 vacant	Signals freely to dispose, with macro programming.

All additional output signals which are indicated in the table are reserved to special functions or only available in **WinPC-NC Professional**.

---

## 7. Additional Information

---

### 7.1. Interpreters

At present, interpreters are implemented in *WinPC-NC Economy* for several NC data formats.

- HPGL
- Drilling data

#### 7.1.1. HPGL-Interpreter

*Plotter data  
with the HPGL  
Interpreter*

The HPGL interpreter recognizes the most important commands in HPGL plotter language. Successful tests have been carried out with various CAD and drawing programs.

Drawings from...

- AutoCAD®
- AutoSketch®
- Eagle®
- HCAM®
- CADdy®
- Malz&Kassner CAD®

*Windows HPGL  
drivers*

...and other CAD systems can be processed without any problems. Furthermore, the interpreter can also work with HPGL data from the standard Window driver HP-Plotter, which programs such as...

- CorelDRAW®
- Designer®

...and other Windows drawing programs use for preparing their data and storing data in a file. Alternatively, it is also possible to use a driver for following plotters: *HP7475, HP Color Pro* or *HP Draftmaster*.

*HPGL Syntax*

**The following commands represent a valid HPGL data file :**

<b>PA</b> [x,y[,x,y]];	Move to absolute position(s)
<b>PR</b> [x,y[,x,y]];	Move to relative position(s)
<b>PU</b> [x,y[,x,y]];	Lift and move tool

<b>PD</b> <i>x,y[,x,y]</i> ;	Lower and move tool
<b>SP</b> <i>x</i> ;	Select tool
<b>IP</b> <i>x,y[,x,y]</i> ;	Define scaling points
<b>SC</b> <i>x,y,x,y</i> ;	Define scaling factors
<b>CI</b> <i>r[,a]</i> ;	Draw complete circle
<b>AA</b> <i>x,y,a[,c]</i> ;	Absolute arc
<b>AR</b> <i>x,y,a[,c]</i> ;	Relative arc

In addition, the interpreter recognizes the following commands although no response is produced on the machine :

<b>DT</b> ...;	<b>LT</b> ...;
<b>LB</b> ...;	<b>VS</b> ...;
<b>IN</b> ...;	<b>CA</b> ...;

The following non-standard expansions can also be used :

<b>PP</b> ;	Drill hole, lower/lift tool
<b>FC</b> <i>t</i> ;	Wait <i>t</i> milliseconds
<b>FC100</b> , <i>t</i> ;	Wait <i>t</i> milliseconds
<b>FC101</b> , <i>i</i> ;	Wait for HIGH level at input <i>i</i>
<b>FC102</b> , <i>i</i> ;	Wait for LOW level at input <i>i</i>
<b>FC200</b> , <i>a</i> ;	Set output <i>a</i> to HIGH
<b>FC201</b> , <i>a</i> ;	Set output <i>a</i> to LOW

HPGL language prescribes the following syntactical rules, amongst others, which must be observed when creating or revising the data.

- There must always be a pair of coordinates *x,y*
- All commands with coordinates must have no, one or more coordinate pairs
- Every command must be followed by a semicolon (;) or a new command
- With PA and PR, the subsequent commands are also set to absolute or relative positioning
- The last command should lift the tool (PU;)

#### *HPGL example*

<b>PU</b> ;	<i>Start by lifting tool</i>
<b>PA</b> 1000,1000;	<i>Then move to 1000/1000</i>
<b>SP</b> 1;	<i>Select tool 1</i>
<b>PD</b> ;	<i>Lower tool</i>
<b>PA</b> 1000,2000;	<i>Move square</i>
<b>PA</b> 2000,2000;	
<b>PA</b> 2000,1000;	
<b>PA</b> 1000,1000;	
<b>PU</b> ;	<i>Lift tool</i>

## 7.1.2. Drilling data interpreter

### *Various drilling data formats*

The drilling data interpreter recognizes data in the following standards Excellon, Sieb&Maier1000 and Sieb&Maier3000.

A drilling file always starts with one or two percent signs and ends with the command M30. In between, there can be any number of lines with X and Y coordinates and the tool number.

### *Drilling data syntax*

The syntax is as follows:

```
% oder %%  
[Xval][Yval][Tx]  
.....  
M30
```

There are two different formats. In format 1, the coordinate values are always 5-digit numbers, although it is possible to leave off the trailing zeros (e.g. X021 corresponds to 2100).

In format 2, leading zeros are discarded and the coordinate values therefore comprise different numbers of digits.

The drilling formats prescribe the following syntactical rules, amongst others, which must be observed when creating or revising the data.

- Every command must be in its own line
- If coordinates and a tool command are contained in the same line, then the tool is changed first before drilling takes place at the position
- The coordinates can also include a decimal point, e.g. X123.456
- All lines before the percent sign(s) are regarded as remarks and are skipped

### *Sample of drilling data in format 2*

Short drilling program in format 2

```
%  
T1  
X1000Y1000  
X1200Y2340  
X2700Y2950T2  
Y1000  
M30
```

### *Remark lines*

```
Start of program  
Select tool 1  
Drill hole at 1000/1000  
Drill hole at 1200/2340  
Tool 2 drill hole at 2700/2950  
Drill hole at 2700/1000  
End of program
```

And here is the same example in format 1: (always 5-digit values, with trailing zeros discarded)

<i>Sample of drilling data in format 1</i>	Short drilling program in format 1	<i>Remark lines</i>
	%	<i>Start of program</i>
	T1	<i>Select tool 1</i>
	X01Y01	<i>Drill hole at 1000/1000</i>
	X012Y0234	<i>Drill hole at 1200/2340</i>
	X027Y0295T2	<i>Tool 2 drill hole at 2700/2950</i>
	Y01	<i>Drill hole at 2700/1000</i>
	M30	<i>End of program</i>

## 7.2. Error messages

Error messages are displayed in a small window in the middle of the screen during operations in **WinPC-NC**. Messages in a gray box do not indicate there is a fault, but only provide information.

**The following error messages may occur :**

- **Limit switch reached**  
The machine has moved on to one of the limit switches. It is necessary to move back from the switch and perform reference rung again before continuing work.
- **Machine not ready**  
The connected controller or machine is not ready or not switched on. **WinPC-NC** works in demo modes.
- **HPGL syntax error**  
There is an invalid HPGL command in the plotter file. It does not correspond to the syntactical rules and therefore cannot be processed by **WinPC-NC**.
- **Connection canceled**  
The connection to the DLL-controller is interrupted. This can happen when other window programs or drives interfere with the realtime tasks.
- **Status stack full/empty**  
An internal error has occurred in **WinPC-NC**. Please report this error to the program authors, providing as many details as possible.
- **Incorrect parameter**  
A parameter in the WPI or WPW file is incorrect or the parameter file has been corrupted.
- **Stop signal detected**  
The stop signal has been detected. Please rectify the fault.
- **Go to reference position first**  
**WinPC-NC** and the controller always need to know what their current position is. Please always perform reference travel after restarting the program.

- **Error xx from controller**

An internal error has occurred in **WinPC-NC** during communication with the realtime module. Please report this error to the program authors, providing as many details as possible.

- **Data cannot be displayed**

The NC data for the current file cannot be displayed graphically. Either they do not match the selected format or they do not contain any tool actions. Another cause for failure may be that the format identification is switched off or that an incorrect data format has been adjusted.

- **Tool not yet defined**

A tool is needed which has not yet been programmed in the tool management system. The appropriate parameters must always be defined prior to using tools.

- **No tool file found**

No tool file can be found. **WinPC-NC** therefore continues to work with default values.

- **Machine is at limit switch**

When both limit switches on an axis are defined, **WinPC-NC** is unable to tell which switch has been reached. Please move the axes in question back from the limit switch manually and then restart reference travel.

- **Service code required**

The axis controller can no longer be controlled and requires a service code before continuing work. Please contact the supplier.

- **Command rejected by controller**

An internal error has occurred in **WinPC-NC** during communication with the realtime module. Please report this error to the program authors, providing as many details as possible.

- **Maschine not ready**

The machine has not been switched on or there is a fault. The *NOT READY* input on the axis controller signals this condition.

- **Communication failed / Timeout**

Communication of **WinPC-NC** interferes with the realtime-DLL. Please report this error to the program authors, providing as many details as possible.

- **Protection hood not closed**

The protective hood or another protective device has not been closed and therefore no process can be started. The machine can still be set up.

- **Command rejected during machine movement**

There is a fault in the connection between **WinPC-NC** and the realtime module. Please report this error to the program authors, providing as many details as possible.

- **File with invalid format**

The selected file does not match the set data format. Change the parameter or the data format to HPGL or drilling format.

- **Help file not found**

The file with the help texts cannot be found. It is called WINPCNC.HLP and must be located in the current folder or in the **WinPC-NC** folder. No help texts can be displayed.



- **Workpiece exceeds working area**

The set working area was exceeded during machining of the current workpiece. It may be possible to rectify this condition by performing reference travel. If not, either change the unit of measurement, move the zero point or increase the working area.
- **Next position outside working area**

The current working process has been cancelled because the next position to which movement should take place is outside the set working area. Correct the settings and restart the working process.
- **Unknown command**

The NC file contains an unknown command and the working process has therefore been stopped. It can now be cancelled or continued with the next command.
- **Cannot create file**

*WinPC-NC* tried unsuccessfully to create a file on the current drive. Either the drive is not ready or it is full, write protected or you do not have any access rights. Correct the problem or change to another drive.
- **No park position defined**

You can only move to the park position if you have defined the corresponding coordinates, i.e. they are set to values other than zero.
- **Required tools not defined**

The working file uses tool numbers which have not yet been defined. The plunge depth and plunge speed must be defined for every tool, and HPGL files also need the feed speed to be defined.
- **Tool moves in too far**

The plunge depth of a tool or the depth and the defined feed corrections are deeper than the maximum plunge depth or the limit of the Z-axis working area.
- **G code or DIN/ISO syntax error**

There is a syntactical error in the G code file being processed. Please use the editor to correct the line in question and restart the working process.
- **Maschine positioned on the reference switch**

You intend to execute a reference move, however there is at least one axis already positioned on the reference switch. Start moving back all axes from the switches by manual operation.
- **Cannot install file**

*WinPC-NC* tried unsuccessfully to install a file. Possible causes are insufficient memory capacity or missing allowance for access in the current register.
- **Out of memory**

There is insufficient vacant main memory space for processing actions by *WinPC-NC*. Please extend the virtual memory in the system control and restart *WinPC-NC*.
- **Hardlock error**

There is problem with recognizing the USB-dongle. Please remove the dongle, if necessary, reinstall the drive and insert it into another USB port. Restarting of the drive is made by calling the file SETUPDRV.EXE in the directory of *WinPC-NC*.
- **Incorrect realtime-DLL**

There are communication problems between the actual realtime module and *WinPC-NC* which are probably caused by another licence.

### **7.3. Special versions of *WinPC-NC***

*Special  
applications  
on request*

The authors are always grateful for opinions and suggestions.

If required, hardware and software solutions can be worked out for your special application, or our standard products can be adapted to optimize their functions for you. Please ask us for a quote without obligation.